



Service Bulletin

File in Section: -
Bulletin No.: 16-NA-259
Date: August, 2016

TECHNICAL

Subject: Rattle Noise from Front Seat Back Easy Entry Release Handle

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2017			All	All

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on hearing a rattle noise coming from the driver or passenger front seat back easy entry release handle. They may note that the noise is more evident during high speed cornering.
Cause	The cause of the condition may be a lack of lubrication on the release cable for the seat back release lever.

Correction




4571157

Dealership technicians are to apply lubricant to the front seat back easy entry release handle, where the seat back release cable resides, following the Service Procedure below.

Service Procedure

1. Move the headrest of the affected seat to the full upward position.

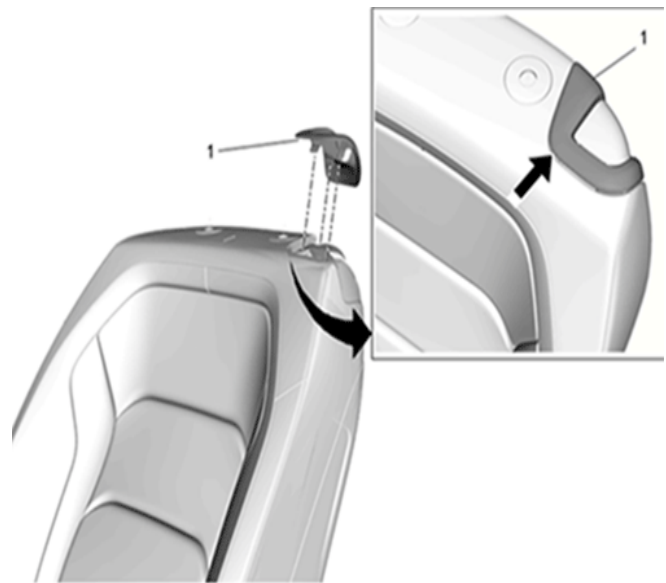

4571158

2. Remove the seat back latch release handle bezel. Refer to *Front Seat Back Latch Release Handle Bezel* in SI.
3. Fold the seat back forward.



4571161

Note: While detached, continue holding the cable barrel (1) with the pliers to ensure cable does not spring back within the handle.

4. Using needle nose pliers, detach the release cable barrel (1) from the latch release handle.




4571164

5. Using a Q-tip® swab, apply GM - A/CDelco Super Lube®* P/N 12371287 (in Canada, use P/N 10953437), or equivalent, into the cable barrel slotted housing of the plastic handle.



4571165

6. Clean off any excessive grease from the handle.

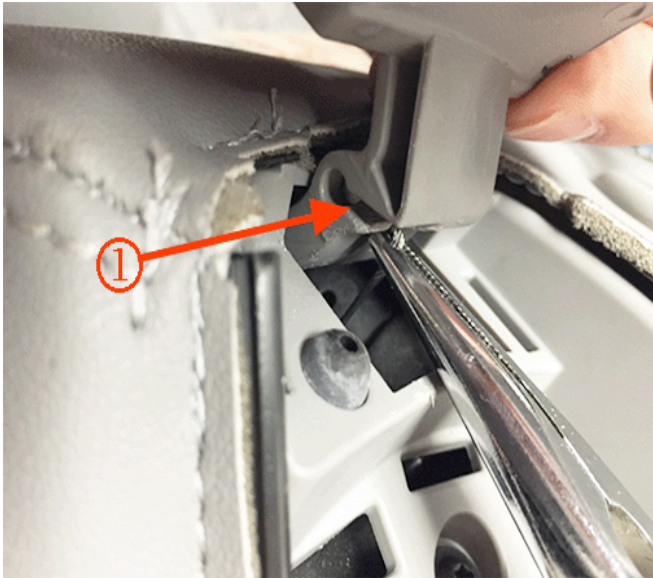

4571168

7. Reinstall the cable barrel back into the slotted handle housing (1) and verify handle operation.
8. Reinstall the seat back latch release handle bezel. Refer to *Front Seat Back Latch Release Handle Bezel* in SI.
9. Return the seat back and headrest to the original positions.

*We believe this source and their products to be reliable. There may be additional manufacturers of such products/materials. General Motors does not endorse, indicate any preference for, or assume any responsibility for the products or material from this firm or for any such items that may be available from other sources.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
7080348*	Lubricate Front Seat Back Easy Entry Handle	0.4 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

