

## **Service Bulletin**

File in Section:

Bulletin No.: 16-NA-260

Date: August, 2016

## **TECHNICAL**

Subject: Rear Seat Entertainment System Does Not Turn On in Very Cold Weather

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
Біапи.	woder.	from	to	from	to		
Cadillac	CT6	2016	2016			All	All

Involved Region or Country	North America, South America, Central America, Caribbean, Israel, Middle East, Africa, Japan, Russia, Europe, S.E. Asia, Middle East, Korea (South) and China.		
Additional Options (RPO)	Equipped with Rear Seat Entertainment Package (RPO UWG)		
Condition	Some customers may comment that the rear seat entertainment system appears inoperable when it is very cold out. The screens will not deploy, the remote will not work, and the center stack will not be able to interact with rear video.		
Cause	This may be due to when the media disk player starts up a soft reset is sent to one of its micro-controllers. When low temperature conditions are present, the micro-controller does not always start up consistently.		
Cause	This condition is detectable by another micro-controller inside the media disk player. When this condition is detected, that micro-controller will send a hard reset to the inactive micro-controller, which will cause it to resume normal operation.		

## Correction

If you encounter a vehicle with the above concern, reprogram the media disc player. Refer to *Media Disc Player Programming and Setup* in SI.

## **Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810815	Media Disc Player Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	

