



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-266

Date: August, 2016

TECHNICAL

Subject: Remote Start Inoperative, Malfunction Indicator Lamp Illuminated

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Envision	2016	2017			LTG	

Involved Region or Country	North America
Additional RPO	BTV
Condition	Some customer may comment on the following conditions: <ul style="list-style-type: none"> Malfunction Indicator Lamp Illuminated. Remote start will not start the vehicle. The Technician may find DTC P0132 and/or P223E set.
Cause	This may be caused by a voltage spike in the ECM, above the threshold value which will set the code P0132 or P223E.

Correction

If the DTC is set in two consecutive cycles, it will turn the MIL on. The MIL will reset after no fault 3 ignition cycles. DTC in history will clear after 40 ignition cycles. This set code will not impact the vehicle performance.

If the conditions have been validated, the ECM must be updated.

Service Information

Update the ECM to the latest software and calibration available. Refer to *Engine Control Module Reprogramming with SPS* in SI.

Warranty Information

Labor Operation	Description	Labor Time
2810075	Engine Control Module Reprogramming with SPS	Use Published Labor Operation Time

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION