

## NOx Sensor Report W17049

www.continental-corporation.com

**Division Naming** 

Cummins PN: 4326873 Conti PN: A2-C959-9180-0-00 SN: 142B9599180001303\_\_150809003119\_P4326873\_\_\_\_\_ CQTS: 300001229933-4 W No.: W17049 VIN: 3C6UR5DL6GG138776 Time/Miles Reported: 2mo/568m

Symptom: FC P2202


Continental Warranty Return Center Analysis: Visual: no anomalies detected. Functional: Passed bubble test. NOx measured out of spec high. Cross check determined sensor as issue.

Supplier Analysis: Supplier detected contamination at contact portion (talc) on female contact between contact and element pad.


Cause:

Talc particles are inherent in the production environment as talc is a necessary part of the sensor product. Continuous improvement actions control talc particles.




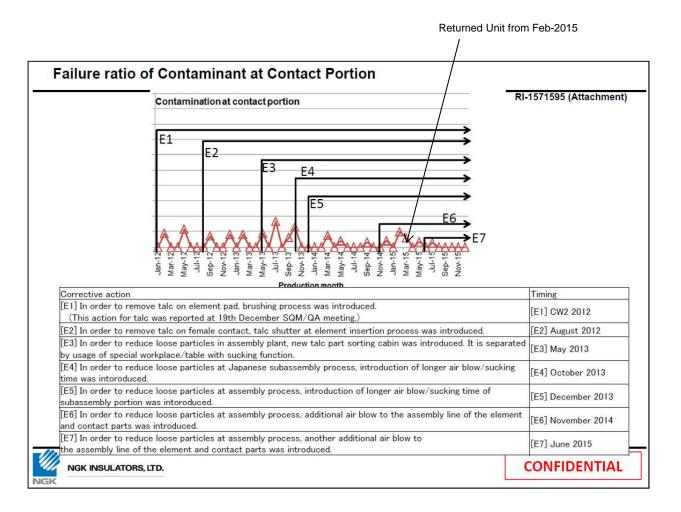


**@**ntinental **☆** 

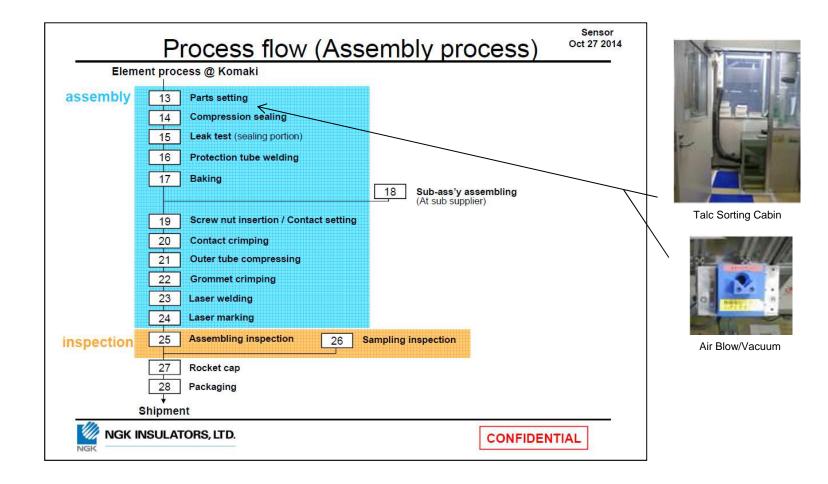


**Ontinental** 

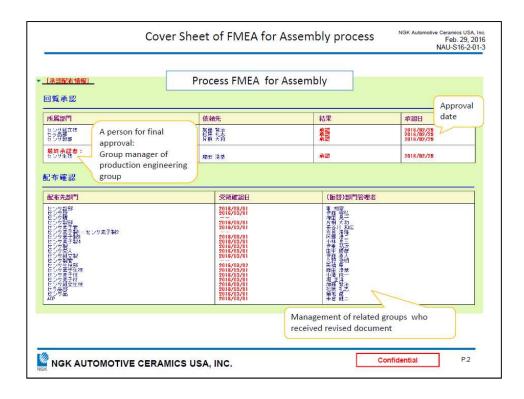



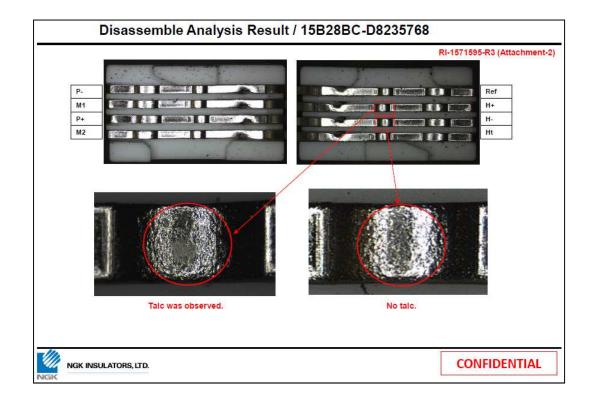



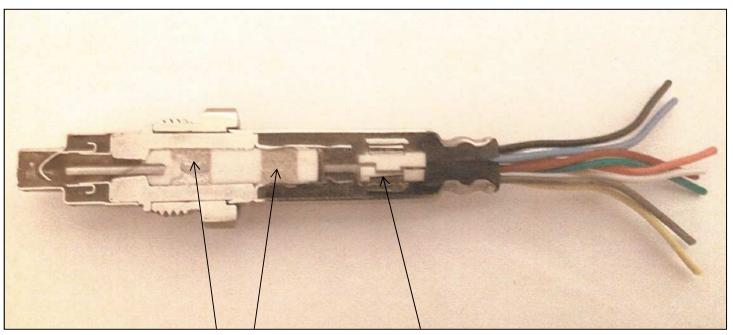

Arrows show talc

Location of particle (occurrence during assembly)



# Thank you

