



Service Bulletin

PRELIMINARY INFORMATION

Subject: Rattle Tick From The Fuel Line At The Fuel Tank

Models: 2015-2017 Cadillac Escalade
2015-2017 Chevrolet Suburban, Tahoe
2015-2017 GMC Yukon Yukon XL
With engines 5.3L, 6.2L RPO's L83, L86

This PI was superseded to update Model Years. Please discard PIP5205.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A vehicle may have a concern of a rattle, tick and/or a vibration from the rear of the vehicle.

This could be coming from the fuel feed line between the fuel tank and ethanol sensor.

Recommendation/Instructions

If the above concern is encountered, apply pressure to the fuel line to determine if this is the source of the concern.

If it is determined the fuel line is the source of this concern replace the fuel feed pipe p/n: 12618338 between the chassis line and the high pressure pump.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4026830	Fuel Feed Pipe Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION