

# Service Bulletin

16-031

**June 11, 2016** 04163 Version 1

# Power Tailgate Won't Open from the Outside in Cold Weather

#### AFFECTED VEHICLES

Year	Model	Trim	VIN range
2015	MDX	ALL	ALL
2016	MDX	2WD	5FRYD3HGB000001 thru 5FRYD3HGB004424
2016	MDX	SH-AWD	5FRYD4HGB000001 thru 5FRYD4HGB013891

### **SYMPTOM**

The power tailgate doesn't open in temperatures near freezing or below, but will work in warmer temperatures.

## **POSSIBLE CAUSES**

The power tailgate outer handle switch is inoperative in cold weather.

### **CORRECTIVE ACTION**

Replace the power tailgate outer handle switch.

### **PARTS INFORMATION**

Part Name	Part Number	Quantity
Switch Sub-Assembly	74811-TZ5-A01	1

# **WARRANTY CLAIM INFORMATION**

The normal warranty applies.


Operation Number	Description	Defect Code	Symptom Code	Flat Rate Time	Template ID	Failed Part Number
8231A7	Replace the power tailgate outer handle switch.	03214	03217	0.5 hr	16-031N	74811-TZ5-A01

Skill Level: Repair Technician

**CLIENT INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

# REPAIR PROCEDURE

- 1. Remove the rear license trim.
- 2. Disconnect the tailgate outer handle switch connector.

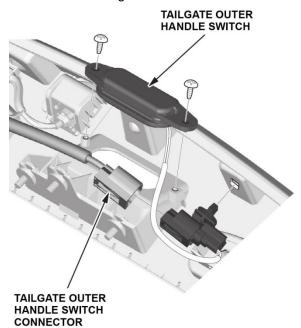

- 3. Remove the tailgate outer handle switch.
- 4. Install the new tailgate outer handle switch.
- 5. Connect the connector.
- 6. Install the rear license trim.

**END**