Bulletin No.: PIP5308A



Date: Apr-2016

# Service Bulletin

## PRELIMINARY INFORMATION

Subject: SES Light P0521 P06DD And Low Oil Pressure

Models: 2015-2016 Cadillac Escalade

2014-2016 Chevrolet Silverado

2015-2016 Chevrolet Suburban, Tahoe

2014-2016 GMC Sierra

2015-2016 GMC Yukon Yukon XL Engine 4.3L LV3 5.3 L83 6.2 L86

This PI was superseded to update Model Years and Recommendation/Instructions. Please discard PIP5308.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition/Concern

Some customers may comment on an SES light DTC's.

#### Recommendation/Instructions

The following should be considered if SI diagnostics has led to an oil pump replacement due to a broken slide:

The oil pump should be replaced.

Remove baffle from the oil pan and shake out any oil pump vanes and other material in pick up tube and oil pan assembly.

If excessive metal debris (dark gray in color) is found, the main and rod bearings should be inspected before engine replacement is considered.

If an indication of bearing wear is found, the crankshaft and bearings can be serviced with the oil pump if needed.

Note: Engine replacement should only occur if there is block damage or excessive debris in the oil passages that can not be thoroughly cleaned out.

### **Warranty Information**

The correction for this concern may be one of several repairs described above. For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safety. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

