

ATTENTION:
 GENERAL MANAGER ☐
 PARTS MANAGER ☐
 CLAIMS PERSONNEL ☐
 SERVICE MANAGER ☐

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2016 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2010-14MY Legacy and Outback Models
SUBJECT: Design Change to Retaining Clip for Front ABS Wheel Speed Sensor

NUMBER: 06-49-15R
DATE: 05/29/15
REVISED: 02/08/16


INTRODUCTION

In response to isolated reports of cracked or broken ABS wheel speed sensor harness retaining clips caused by reaction with acids used in some wheel cleaners, the clip material has been changed to polypropylene (PPO).

PART INFORMATION

The new retaining clips can be identified by the molded in >PP< as shown in the photo below. There are 2 clips on each sensor harness.

PART NAME:	PART NUMBER:	QTY REQUIRED:
CLIP ABS SENSOR	SOA635142	4 Per Vehicle

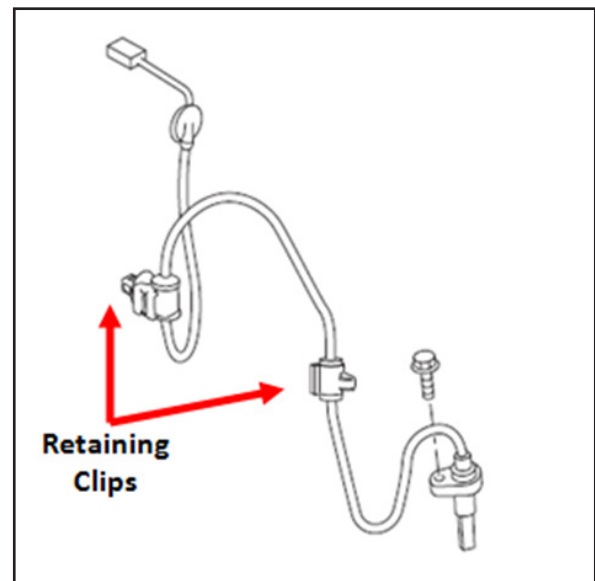

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE / INFORMATION

IMPORTANT: In the event a cracked or broken sensor harness retaining clip is identified, **all 4** of the clips (2 per side) **MUST** be replaced.

CAREFULLY remove the retaining clips from the sensor harness and always install the replacement clips back in the same position as the originals.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period or with an active Added Security Classic or Gold Service Agreement, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
LEGACY / OUTBACK FRONT ABS WHEEL SPEED SENSOR HARNESS CLIPS - REPLACE ALL (4)	A566-014	UQX-01	0.5

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.