May 7, 2016

03585 Version 2

Audio Unit Software Update

HONDA

Supersedes 16-022, dated May 5, 2016, to include REQUIRED TOOLS, WARRANTY CLAIM INFORMATION, and REPAIR PROCEDURE INFORMATION.

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2016	Civic	2-Door EX 1.5L	2HGFC3GH thru 2HGFC3GH
2016	Civic	2-Door Touring 1.5L	2HGFC3GH thru 2HGFC3GH
2016	Civic	4-Door EX 1.5L	19XFC1GE thru 19XFC1GE
2016	Civic	4-Door EX 1.5L	2HGFC1GH thru 2HGFC1GH
2016	Civic	4-Door EX 2.0L	19XFC2GE thru 19XFC2GE
2016	Civic	4-Door EX 2.0L	2HGFC2GH thru 2HGFC2GH
2016	Civic	4-Door Touring 1.5L	19XFC1GE thru 19XFC1GE
2016	Civic	4-Door Touring 1.5L	2HGFC1GH thru 2HGFC1GH

BACKGROUND

There is a problem with the audio unit software, which may lead to one or more of the following symptoms:

- *Bluetooth*[®] Audio skips.
- Audio icon does not work.
- GPS error code 1302 sets.
- Error message **SXM check tuner** appears.
- GPS initialization screen appears.
- Rear camera is stuck on in Park.
- Bluetooth[®] HandsFreeLink[®](HFL) pairing problems.

- Rear camera does not display.
- There is no sound from Apple CarPlay[™] after connecting *Bluetooth*[®], then USB.
- System does not recognize "SXM" in voice commands.
- Pandora[®] does not play after HFL call ends.
- Voice commands do not work.
- Android Auto[™] will not play.

CORRECTIVE ACTION

Update audio unit software using the audio-navigation system USB update device.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation	Description	Flat Rate	Defect	Symptom	Template	Failed Part
Number		Time	Code	Code	ID	Number
0100A1	Update the audio unit software.	0.3 hr	03214	03217	16-022A	39101-TBA-A21

Skill Level: Repair Technician

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REQUIRED TOOLS

Tool Name	Part Number
Audio-Navigation System Update Device (USB Drive)	07AAZ-TBAA100



REPAIR PROCEDURE

NOTE: Connect a battery charger or a fully charged jumper battery to the vehicle and leave it connected during the entire update procedure to maintain a steady voltage.

- 1. On the HOME screen, press and hold the MENU icon, AUDIO icon, and Day/Night button at the same time for 3 seconds.
- 2. Select Detail Information & Setting.



3. Select Version.

	Return
Monitor Check	B-CAN
Unit Check	F-CAN
Audio Cheok	Version
Guideline Setup	Vehicle status
Functional Setup	GPS Information

- 4. Scroll to **System** μ **Com** and check the version.
- If you have version H61F00 70.E2.12 / H62F00 70.E2.12, go to the applicable software update procedure.
- If you have version H61F00 70.E0.12 / H62F00 70.E0.12, go to the applicable software update procedure.

	Return
	HUL G2P Engine 20.8.0
	HUL TTS Engine1.0.2
	VehicleDbManager1.0
	com.mitsubishielectric.ada.util.vehiclerw4.2.2-15 2
DBOOT	1.9_20160215194806
Software loader	1.F186.67
System µCom	H62F00 70.E2.12

5. After checking the version select **Return** 3 times to return to the HOME screen.

Software update procedure for System µCom H61F00 70.E2.12 / H62F00 70.E2.12.

- 1. Connect the USB update device once the audio unit has booted up and the HOME screen appears.
- 2. Once the USB device is inserted, a pop-up screen appears with the current and new software versions displayed. (This may take a minute or two) Select **Yes.**

NOTE: Once you start the update, you do not have to stay with the vehicle.

AUDIO SOURCE	Ay.		7:1	9
Audio	Id you like	to update	Phone 7	
Current New	Ver. 1. Ver. 1.	F183.52 F186.69		
Yes			No	
		• •		

The main software update screen will appear and the update is copied from the USB device.



Once the update is copied, the audio unit reboots automatically.



3. You may get a GPS check pop-up, if you do, follow the instructions to acquire the GPS signal. NOTE: If you cannot acquire the GPS signal, remove the USB device and go to step 4.

> The system lost power and is acquiring its location from the GPS satellites. This usually takes less than 10 minutes. * Start the engine. * Park the vehicle in an open area away from trees, power lines, and tall buildings. * Remove loose articles, mobile phones, or electrical accessories located near the GPS antenna. * If this screen is displayed repeatedly when starting the vehicle, see your dealer.

4. Once the HOME screen reappears, remove the USB device and go to SOFTWARE UPDATE CONFIRMATION.



Software update procedure for System µCom H61F00 70.E0.12 / H62F00 70.E0.12.

- 1. Connect the USB update device once the audio unit has booted up and the HOME screen appears.
- Once the USB device is inserted, a pop-up screen appears with the current and new software versions displayed. (This may take a minute or two) Select Yes.

NOTE: Once you start the update, you do not have to stay with the vehicle.

AUDIO	SOURCE	R _y				7:19
	Audio		ſ	٥	Phone	6
	Woul	d you li	ke te	o updat	e?	
	Current New	Ver. Ver.	1.F1 1.F1	83.52 86.69		
	Yes				No	
	/		τ	~		

The main software update screen will appear and the update is copied from the USB device.

Current	Ver.	XXXXXXX	-
New	Ver.	XXXXXX	
.e ——			33%
Planca da	Copying	L	iala
or discor	nect the	USB devic	e.

Once the update is copied, the audio unit reboots automatically.



The system software update screen will appear and the software should finish downloading.



Once the update is complete, the audio unit reboots automatically a second time.



- 3. The **Anti Theft System** screen will appear. Push and hold the AUDIO icon for more than 2 seconds to enable the system.
 - NOTE: If nothing is done for 30 seconds the screen will go black, select the Day/Night button or BACK icon to return to the screen.



4. You may get a GPS check pop-up. If you do, follow the instructions to acquire the GPS signal. NOTE: If you cannot acquire the GPS signal, remove the USB device and go to the next step.

> The system lost power and is acquiring its location from the GPS satellites. This usually takes less than 10 minutes. * Start the engine. * Park the vehicle in an open area away from trees, power lines, and tall buildings. * Remove loose articles, mobile phones, or electrical accessories located near the GPS antenna. * If this screen is displayed repeatedly when starting the vehicle, see your dealer.

5. Once the HOME screen reappears, remove the USB device and go to SOFTWARE UPDATE CONFIRMATION.



SOFTWARE UPDATE CONFIRMATION

- 1. On the HOME screen, press and hold the MENU icon, AUDIO icon, and Day/Night button at the same time for 3 seconds.
- 2. Select Detail Information & Setting.



3. Select Version.

	Return
Monitor Check	B-CAN
Unit Check	F-CAN
Audio Check	Version
Guideline Setup	Vehicle status
Functional Setup	GPS Information

4. Scroll to **Software loader** and **System μCom** and check the versions. The software should be updated to the following:



- Software loader : 1.F186.69
- System µCom : H61F00 70.E2.12 (with XM radio function)
 - H62F00 70.E2.12 (without XM radio function)

5. After verifying the software has been updated, select **Return** 3 times to return to the HOME page. Go to DELETING ERROR HISTORY.



DELETING ERROR HISTORY

- 1. On the HOME screen, press and hold the MENU icon, AUDIO icon, and Day/Night button at the same time for 3 seconds.
- 2. Select Detail Information & Setting.



3. Select Unit Check.

	Return
Monitor Check	B-CAN
Unit Check	F-CAN
Audio Check	Version
Guideline Setup	Vehicle status
Functional Setup	GPS Information

4. Select Error history.



5. Select Hard Error.



6. Select **Clear** on the bottom right.

			Return
		20150101 020309	
Date	20150101	20150101 015750	
Time	015035	20150101 015035	
Error code	1302	20150101-014715	
Simple description	GPS Receiver Error1	20150101 011815	
-		20150101 011458	
		Save	Clear

7. Select Yes on the Confirmation screen. The error history is now cleared, and the update complete.

				Return
Date	Confirmation Deleted data canno	at be recovered.		
Time	Continue?			
Error code	Yes	No		
Simple description				
		Save	Clear	

END