

September 30, 2016

04934 Version 1

## Rubbing, Popping or Clicking From Front Door When Opening

### AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2015–16	TLX	ALL	ALL
2017	TLX	L4 2WD	19UUB1...HA [REDACTED] thru 19UUB1...HA [REDACTED]
2017	TLX	V6 2WD	19UUB2...HA [REDACTED] thru 19UUB2...HA [REDACTED]
2017	TLX	V6 AWD	19UUB3...HA [REDACTED] thru 19UUB3...HA [REDACTED]

### SYMPTOM

There is a rubbing, popping, or clicking type noise from one or both of the front doors when opened.

### POSSIBLE CAUSE

The door gap seal, on the leading edge of the front doors contacts and rubs against the front fender when opening the door.

### CORRECTIVE ACTION

Identify the side making the noise, and replace the front door gap seal on that affected side. **Do not** adjust the door or fender to resolve the noise because it may cause a road or wind leak noise inside the cabin.

### PARTS INFORMATION

Part Name	Part Number	Quantity
Right Side Front Door Gap Seal	72336-TZ3-A02	1
Left Side Front Door Gap Seal	72376-TZ3-A02	1

### WARRANTY INFORMATION


Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
8161C1	Replace front door gap seal – right side.	0.2 hr	07403	04201	16-058N	72336-TZ3-A01
8151C0	Replace front door gap seal – left side.	0.2 hr	07403	04201	16-058P	72376-TZ3-A01
8151C1	Replace front door gap seal – both sides.	0.3 hr	07403	04201	16-058Q	72376-TZ3-A01

Skill level: Repair Technician


**CLIENT INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

## REPAIR PROCEDURE

1. Identify the side making the noise by opening and closing the front doors.

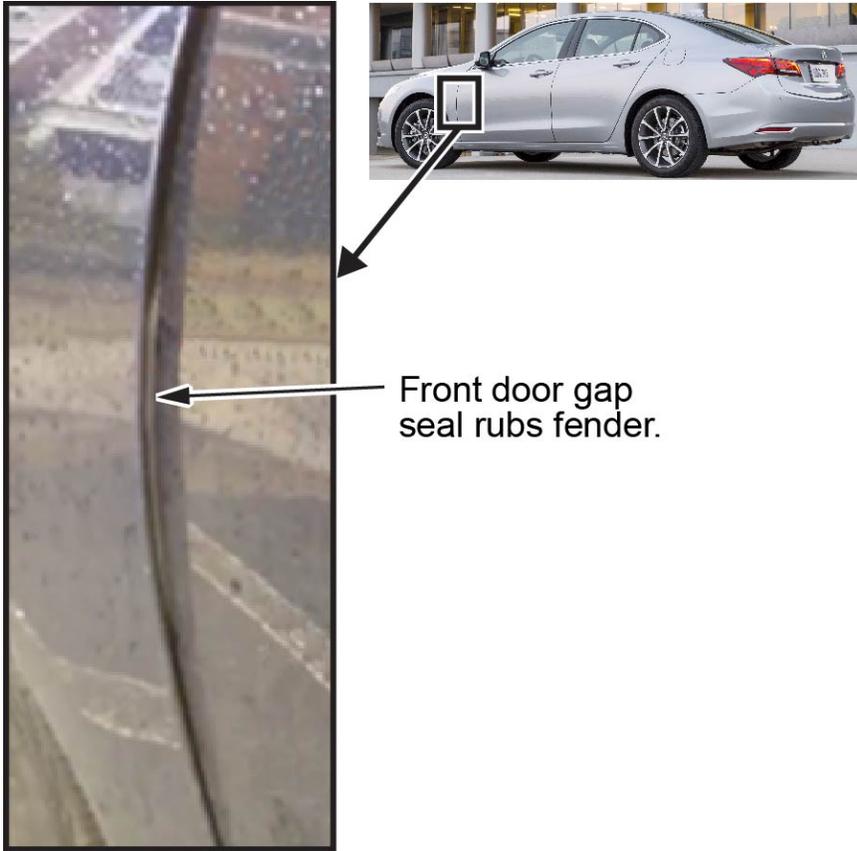


2. Open the front door on the side making the noise, and remove all of the fasteners on the front door gap seal.

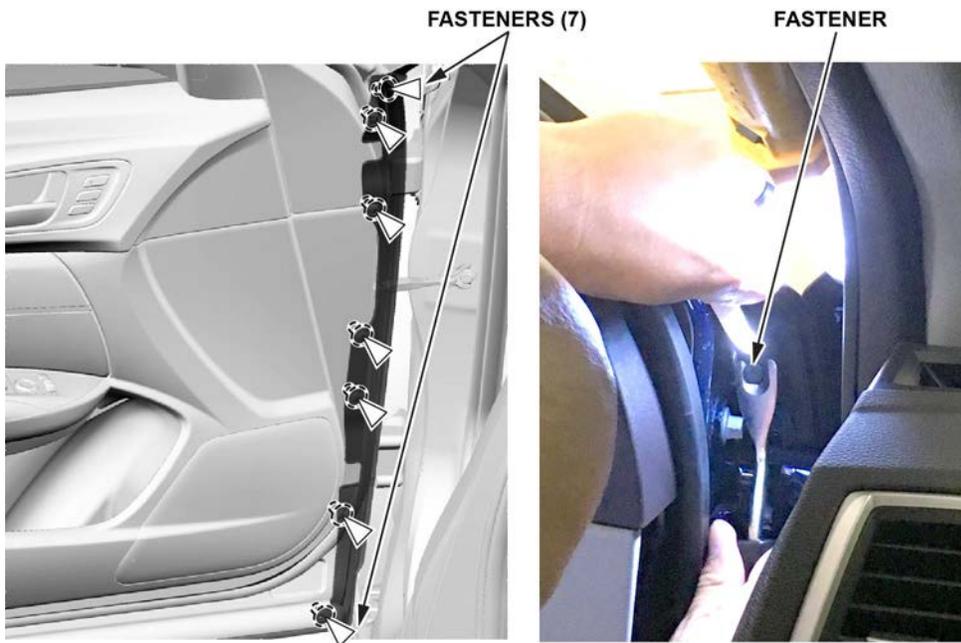

3. Once all the fasteners are removed, pull the seal up and out to remove it from the doorjamb area.



4. Install a new front door gap seal behind the door hinges, and install each fastener into its slotted hole.

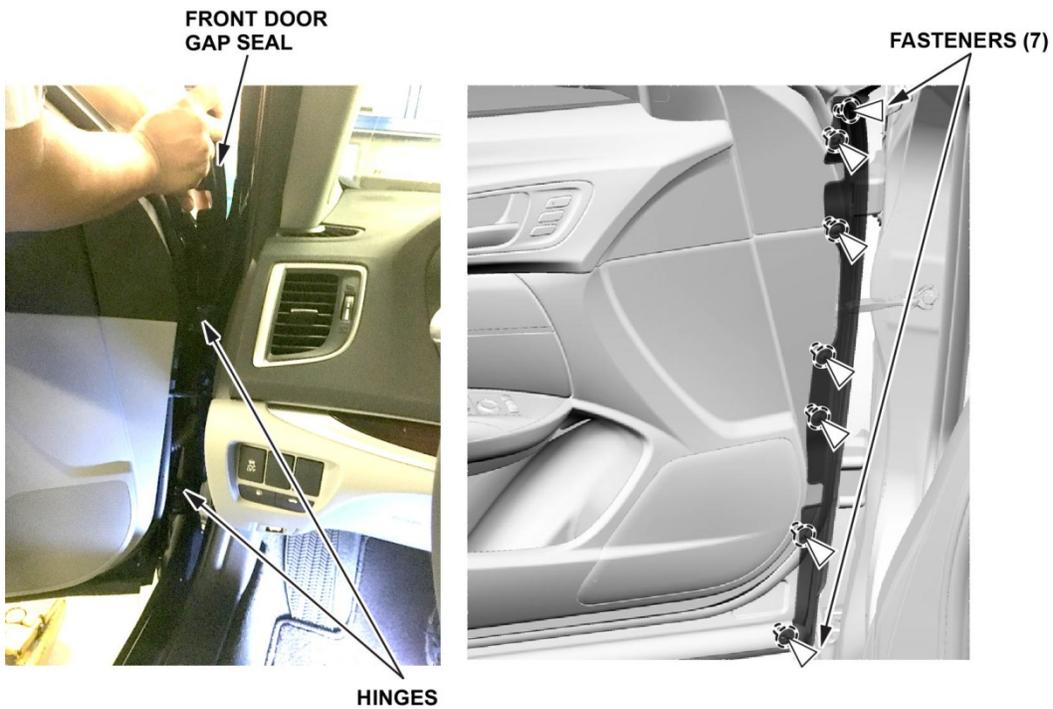

5. Open and close the door multiple times to confirm the noise is gone.

END