



# Technical Journal

TITLE:

**BLIS Constant warning without any object in the blind spot area**

<b>REF NO:</b> TJ 30908.3.0	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7510 Volvo Car USA		<b>ISSUE DATE:</b> 2016-09-19	<b>STATUS DATE:</b> 2016-09-22
<b>FUNC GROUP:</b> 3872	<b>FUNC DESC:</b> Collision avoidance	Page 1 of 2	

“Right first time in Time”

## Attachment

## Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
134							2016-2016	21	0390000-0400847	201517-201536
134							2016-2016	22	0390000-0403002	201517-201538
134							2016-2016	25	0392952-0392959	201519-201525
137							2016-2016	22	0000001-0000734	201524-201538
138							2016-2016	36	0085001-0098405	201517-201538
155							2016-2016	21	0285001-0299117	201517-201536
155							2016-2016	25	0286661-0291584	201519-201524
156							2016-2016	22	0775000-0837519	201517-201538
156							2016-2016	25	0781030-0804142	201518-201525
156							2016-2016	36	0775005-0835109	201517-201537
157							2016-2016	21	0003001-0009026	201521-201536
256							2016-2016	21	0000561-0028152	201505-201539

## CSC Customer Symptom Codes

Code	Description
XR	Blind spot information system (BLIS)/Does not work
YC	Cross Traffic Alert (CTA)/Does not work



## VST Operation Number

VST Operation Number	Description
36707-2	Side Obstacle Detection Control Module left (SODL) replace
36004-2	Software control module downloading
36708-2	Side Obstacle Detection Control Module Right (SODR) replace
36065-3	Calibration SODL/SODR (road driving)

## DTC Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

## Text

### DESCRIPTION:

\* Changed VST Operation No.

If the vehicle shows a constant BLIS warning light without any objects in the blind spot, then this could be caused by a HW problem in the Side Object Detection radar (SODL/SODR). Then follow the advice under Service.

### SERVICE:

In case of customer complaints for above symptom is confirmed, replace the SODL or SODR on the side for which the symptom is shown and download software SOD Reload.

### VEHICLE REPORT:

Only if this TJ does not solve the problem for above chassis number ranges or if the symptom would occur after the chassis number ranges. Use concern area "Vehicle Report" and sub concern area "Support Needed", use function group 3872.