



Service Bulletin

File in Section: -


Bulletin No.: 16-NA-198

Date: June, 2016

TECHNICAL

Subject: Holes/Tears in Fabric of Sunroof Air Deflector

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	CT6	2016	2016	SOP 2016	Prior to 1G6KK-5R66GU1-51485	All	All



Involved Region or Country	NORTH AMERICA, JAPAN, KOREA, RUSSIAN FEDERATION, MIDDLE EAST, EUROPE, ISRAEL
Additional Options (RPO)	Equipped with Sunroof (RPO C3U)
Condition	 <p style="text-align: right; font-size: small;">4533530</p> <p>Some customers may comment on seeing tears (1) or a large hole in the sunroof air deflector fabric.</p>
Cause	The cause of the condition may be an interference where the air deflector is contacting the sunroof housing front beam and guide rails.

Correction

Replace the sunroof air deflector and reposition the deflector pivot brackets following the Service Procedure below.

Service Procedure

1. Remove the sunroof air deflector. *Refer to Sunroof Air Deflector Replacement (With C3U) in SI.*

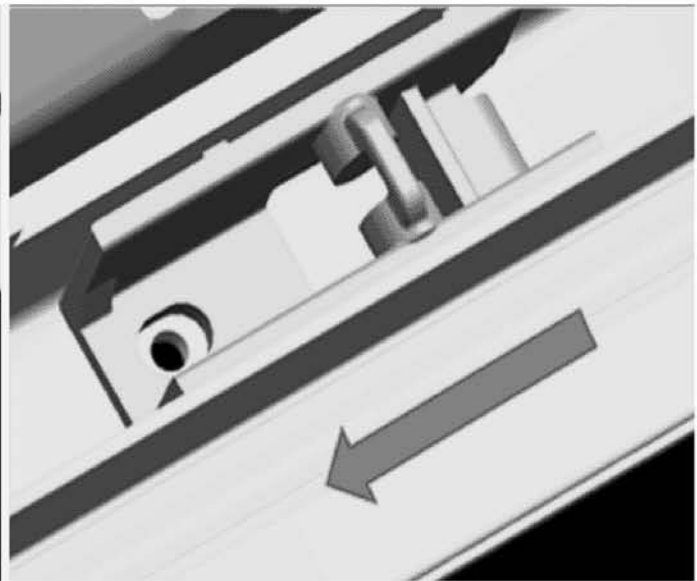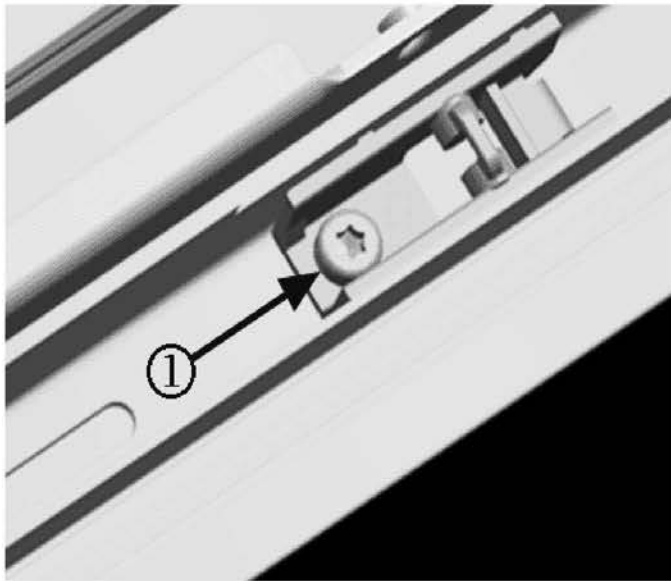

4533533

2. Before installing the new deflector, reposition the deflector pivot brackets:
 - 2.1. Remove the pivot bracket retaining screw (1).
 - 2.2. Move the pivot bracket to the forward position.
 - 2.3. Reinstall the screw.

Tighten.

Tighten the screw to a **maximum 1.5 N•m (13 lb in)**.

- 2.4. Repeat steps #2.1–2.3 on opposite side.
3. Install the new sunroof air deflector. *Refer to Sunroof Air Deflector Replacement (With C3U) in SI.*

Parts Information

Description	Part Number	Qty
DEFLECTOR ASM-SUN RF AIR	23387126	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6040070	Sunroof Air Deflector Replacement	Use Published Labor Operation Time

Version	1
Modified	

