
	GROUP CHA	MODEL Multiple Models
	NUMBER 074	DATE August 2016
TECHNICAL SERVICE BULLETIN		
SUBJECT: MDPS FLEXIBLE COUPLING REPLACEMENT		

This bulletin is issued to provide information about the replacement of the flexible coupling in the MDPS motor of some vehicles which might experience a “knock” noise originating from the MDPS, when moving the steering wheel to right or left when the vehicle is stopped. This is caused by premature wear of the flexible coupling in the MDPS motor. If any “knock” noise from the MDPS occurs, replace the affected flexible coupling only with an improved one, following the Replacement Procedure below.

Please note that Replacement Procedures 1, 2 and 3, as shown below, vary depending on the model. Calibration Procedures only apply to Replacement Procedures 1 and 3. For reference, there are 2 types of torque sensors to detect revolution and torque in the MDPS system. One is the optical type which detects when light is transmitted and the other is the magnetic type which detects changes in polarity.

Procedure	Model/Year	Applicable Production Range	Replacement Part
1	Forte (TD) / 2012~2013	From Jan. 05, 2012 ~ Mar. 31, 2013	
2	Soul (AM) / 2010~2013	From Sep. 01, 2009 ~ Aug. 15, 2013	
	Forte (YD) / 2014	From Jan. 7, 2013 ~ Dec. 18, 2013	
3	Cadenza (VG) / 2014	From Feb. 01, 2013 ~ Apr. 19, 2014	

File Under: <CHASSIS>

Circulate To: ☒ General Manager ☒ Service Manager ☒ Parts Manager
☒ Service Advisor(s) ☒ Technician(s) ☒ Body Shop Manager ☐ Fleet Repair

Replacement Procedure 1: This procedure applies to Forte (TD) models.

1. Remove the MDPS unit by referring to the applicable procedure on KGIS.

★ NOTICE



Before removing the MDPS unit, make sure to align the steering wheel to the center position.

2. Locate the steering column guide bracket (A) and remove four (4) Torx® head screws (B/C) securing it to the steering column.


Tightening torque:

B: 3.6 lb-ft (4.9 Nm)

C: 2.2 lb-ft (2.9 Nm)

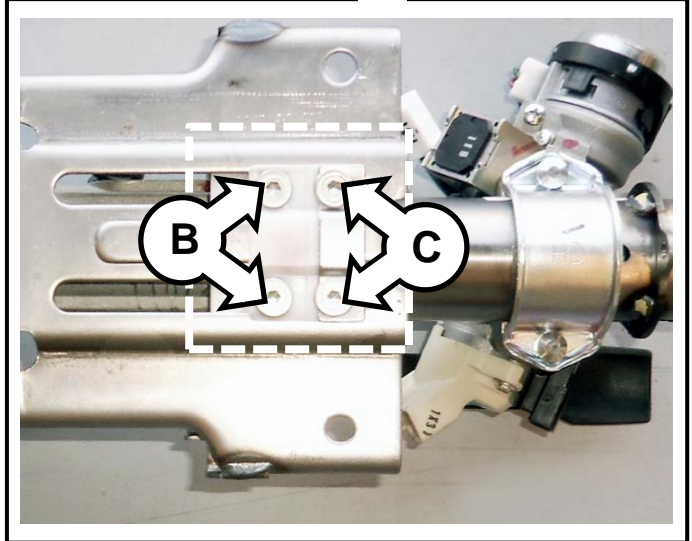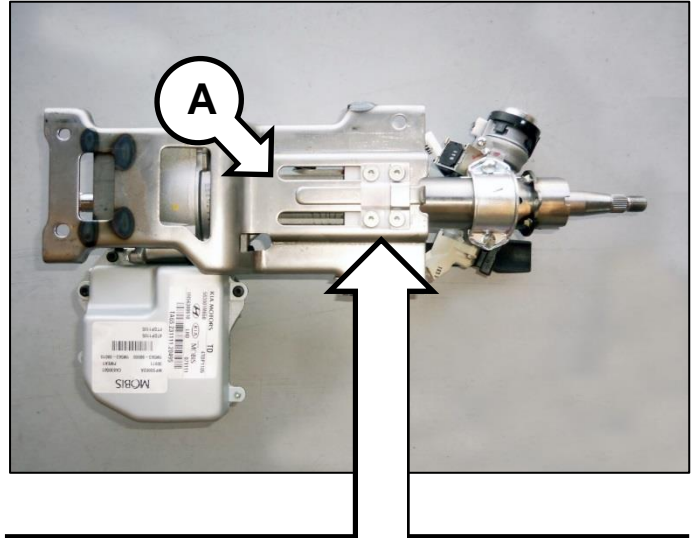

3. Lift the steering column guide bracket (D) and remove the plastic spacer (E). Retain all parts as they will be reused.

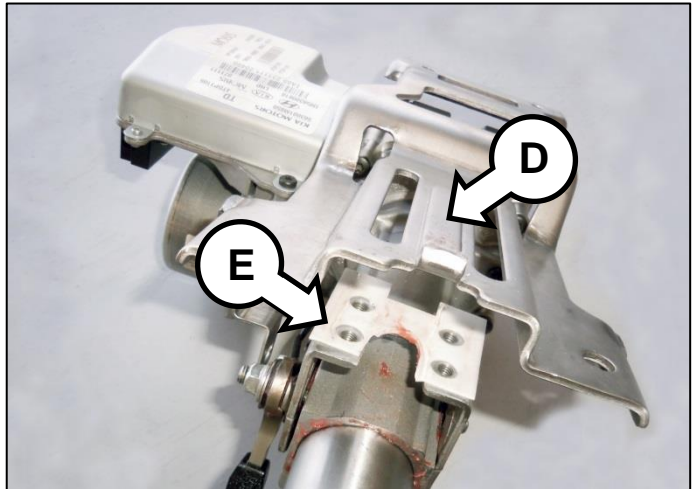


SUBJECT:


MDPS FLEXIBLE COUPLING REPLACEMENT

4. Remove the steering column guide bracket hinge bolt (F)

Tightening torque:
13~14.5lb-ft (17.7~19.6 Nm)

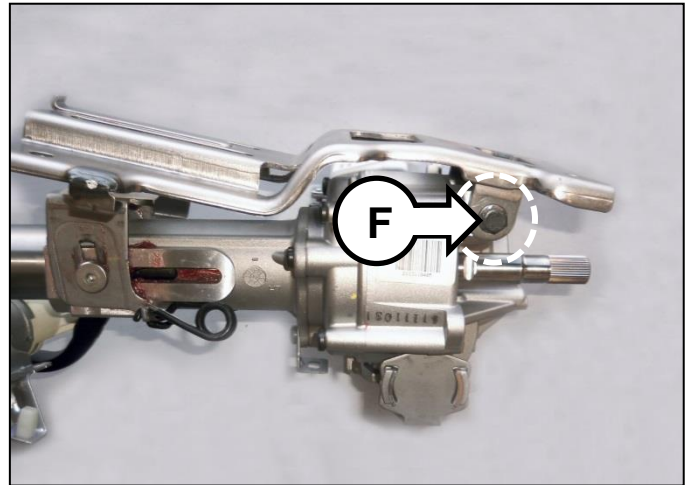


5. Remove the steering column guide bracket (G) from the steering column.

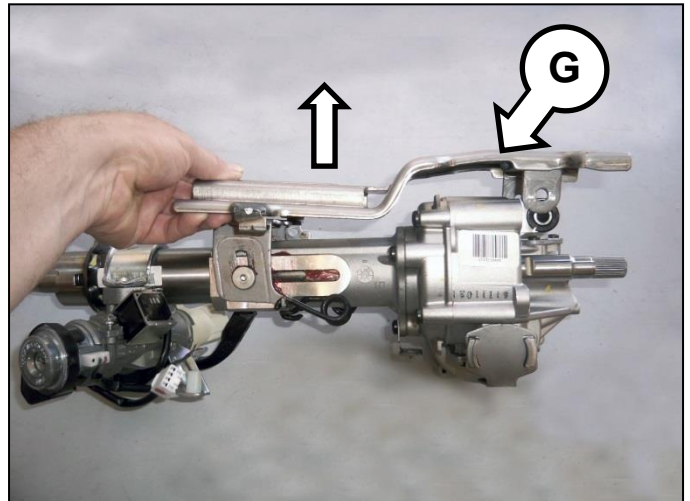

6. Hold the MDPS upright and loosen four Torx® head screws (H) securing the column to the motor housing.


Tightening torque:
6.5~9.4lb-ft (8.8~12.7 Nm)

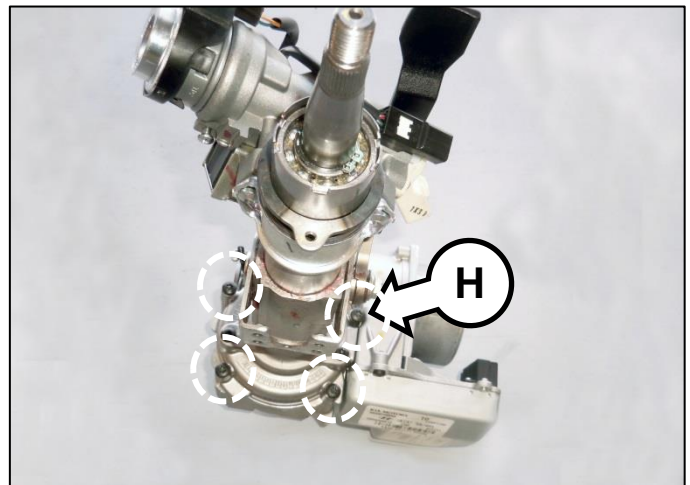

SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT

7. Separate the upper half (I) of the motor housing from the lower half (J).

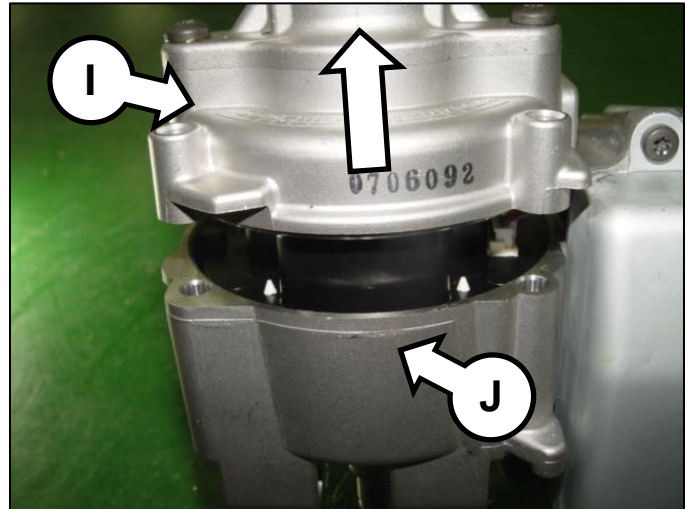


8. Remove the washer-gasket (K) and connector (L) from lower portion of the MDPS.



CAUTION


To avoid damage, use caution when removing the connector.

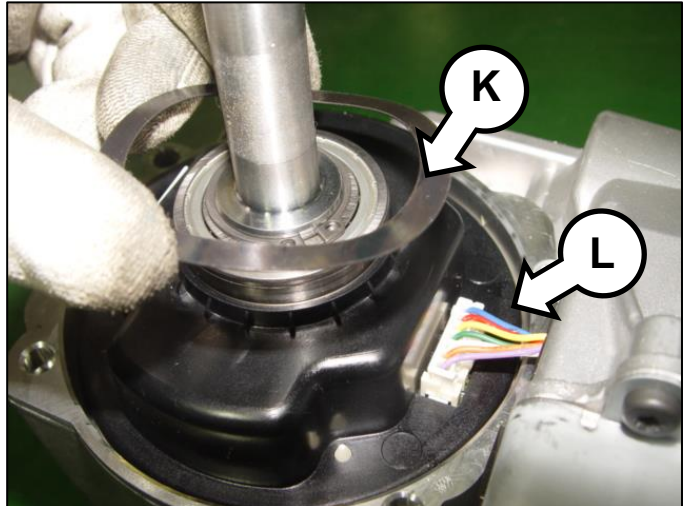

9. Remove the 3 Torx® head screws (M) securing the MDPS ECU cover.

Tightening torque:

3.6~5.1lb-ft (4.9~6.9Nm)

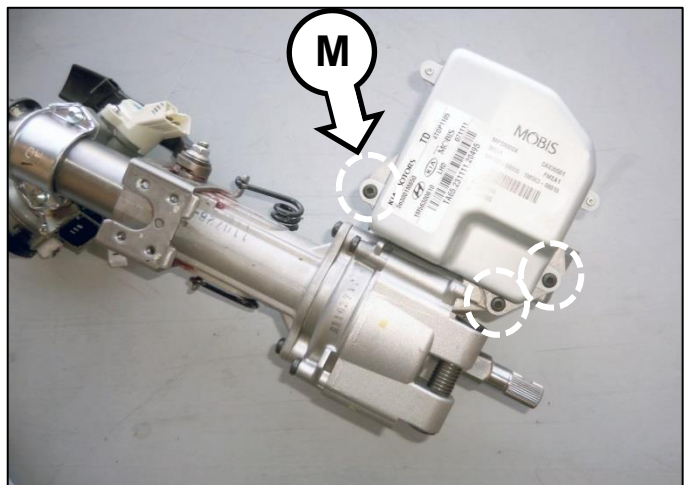


SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT

10. Remove the 4 Torx® head screws (N) securing the MDPS motor cover.


Tightening torque:
3.6~5.1lb-ft (4.9~6.9Nm)

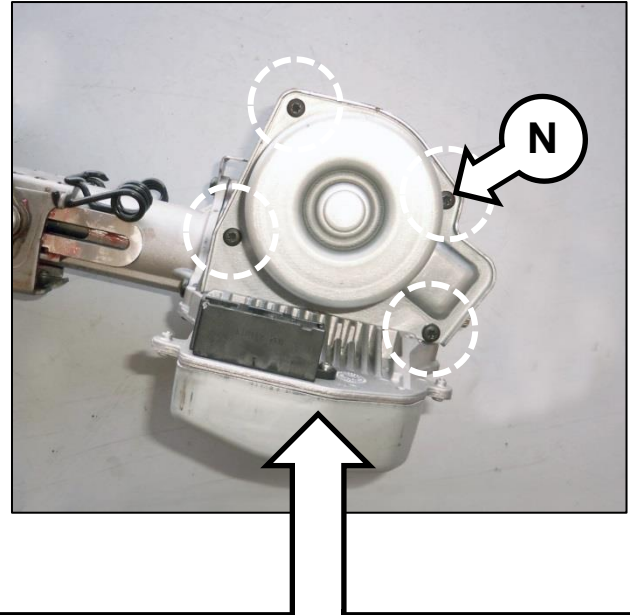


11. Remove the MDPS motor cover.

**CAUTION**

To avoid damage, use caution when removing the connector and the wiring harness.

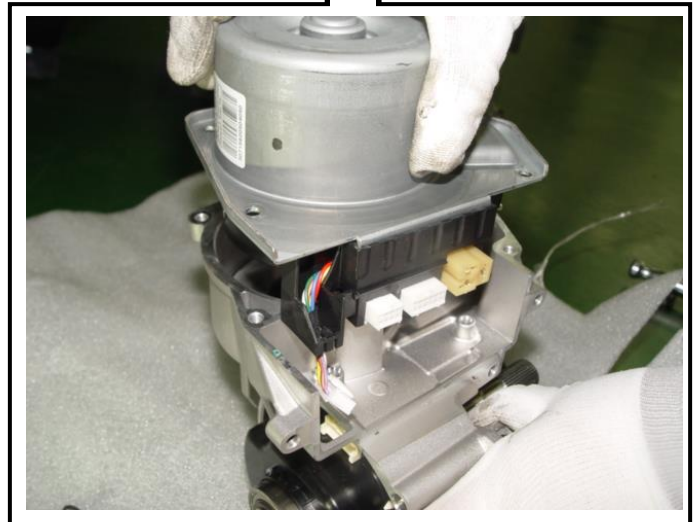

12. Remove the original flexible coupling (O) from the housing. In addition, use an air gun to remove any foreign matter from the motor and/or the housing.

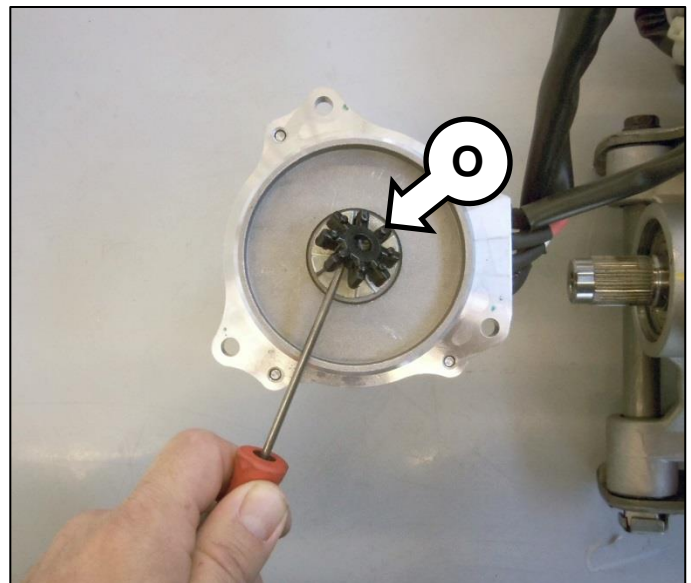


SUBJECT:**MDPS FLEXIBLE COUPLING REPLACEMENT**

13. Replace the original flexible coupling with the new part. Refer to the graphic below to properly align the flexible coupling with the motor housing.

★ NOTICE

Before installing the new part, make sure it has “HNBR” embossed on the surface and is facing upward.

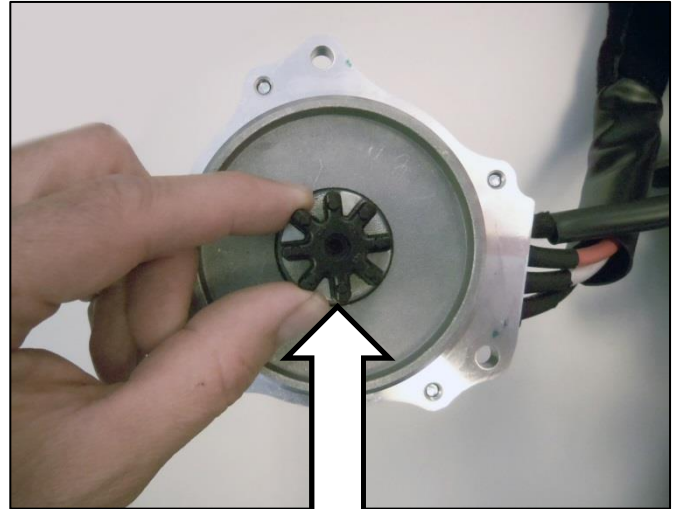

14. Reinstall all removed components by reversing the order of removal. Perform the **Calibration Procedure found on page 13.**

★ NOTICE

Before re-installing the MDPS unit, make sure the front wheels are pointing straight ahead.

SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT

Replacement Procedure 2: This procedure applies to Soul (AM), and Forte (YD) models.

NOTE: Images shown are for general information and not representative of each model's actual configuration.

1. Remove the crash pad lower panel (A) by referring to "Body (Interior and Exterior) → Interior → Crash Pad → Repair procedures" on KGIS.



2. Loosen three (3) steering column shroud retaining screws (B) and then remove the steering column upper and lower shrouds.

*** NOTICE**

When loosening the steering wheel column shroud fixing screws, turn the steering wheel 90° to the left/right from aligned position.



3. Disconnect the MDPS electrical connectors (C).



SUBJECT:


MDPS FLEXIBLE COUPLING REPLACEMENT

4. Disconnect the multifunction switch, wiper and washer switch, airbag, and heated steering wheel electrical connectors.



5. Loosen both steering column retaining bolts (D) and rear bolt (E) and lower the steering column assembly.

Tightening torque:
9.4~13.0 lb-ft (12.7~17.7 Nm)

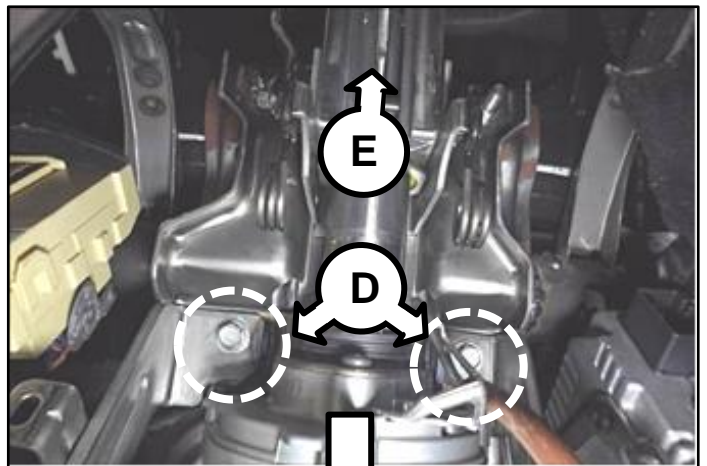


SUBJECT:


MDPS FLEXIBLE COUPLING REPLACEMENT

6. Loosen the three MDPS motor retaining bolts (F) and lift the MDPS motor and set it to the side.

Tightening torque:
5.8~8.7 lb-ft (7.8~11.8 N-m)

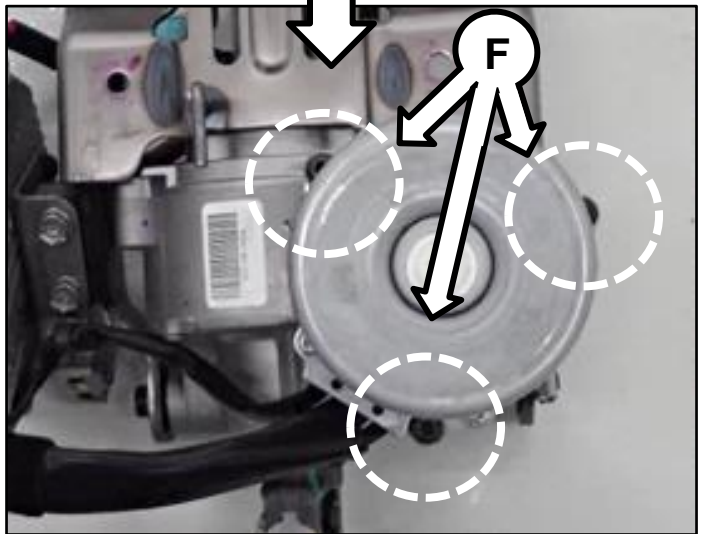

7. Remove the original flexible coupling (D) from the motor. In addition, use an air gun to remove any foreign matter from the motor and/or the housing.

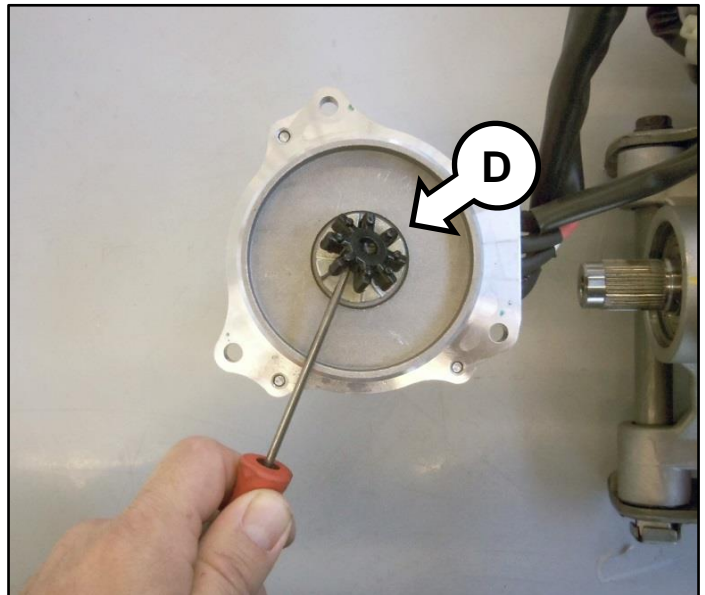


SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT

8. Install the new flexible coupling (E) onto the MDPS motor, as shown.

*** NOTICE**

Before installing the new flexible coupling, make sure it has “HNBR” embossed on the surface and is facing upward.

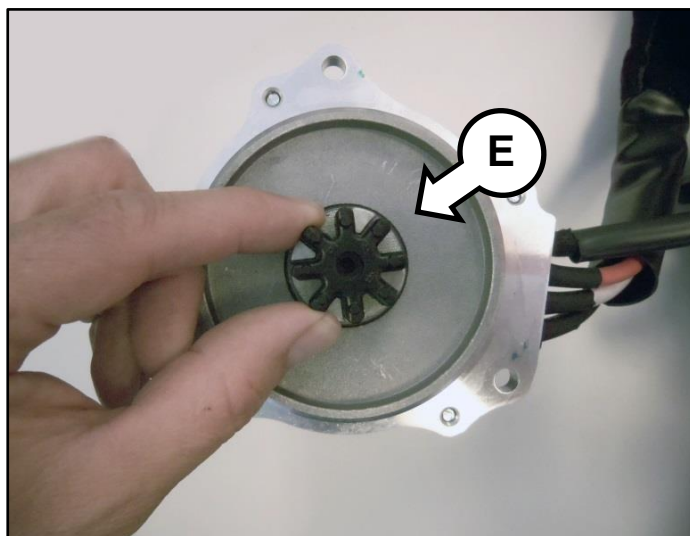

9. Reinstall all removed components by reversing the order of removal.

SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT


Replacement Procedure 3: This procedure applies to Cadenza (VG) models.

NOTE: Images shown are for general information and not representative of each model's actual configuration.


★ NOTICE

Before removing the MDPS unit, make sure to align the steering wheel to the center position.

1. Remove the MPDS unit by referring to the applicable procedure on KGIS.
2. Remove 3 bolts (A) securing the MPDS motor to the housing.

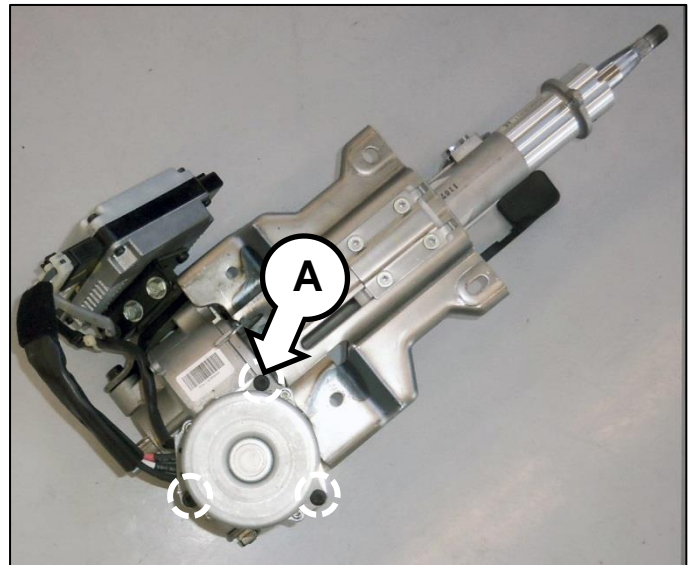


3. Separate the MDPS motor (B) from the housing (C), as shown.

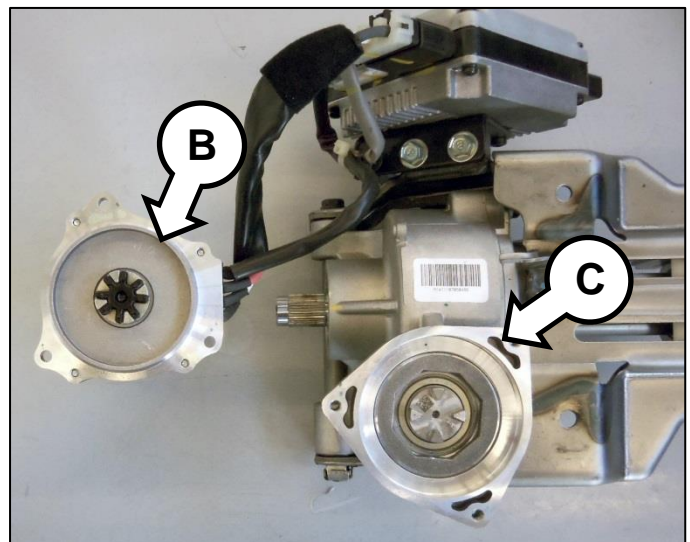

SUBJECT:**MDPS FLEXIBLE COUPLING REPLACEMENT**



4. Remove the original flexible coupling (D) from the motor. In addition, use an air gun to remove any foreign matter from the motor and/or the housing.

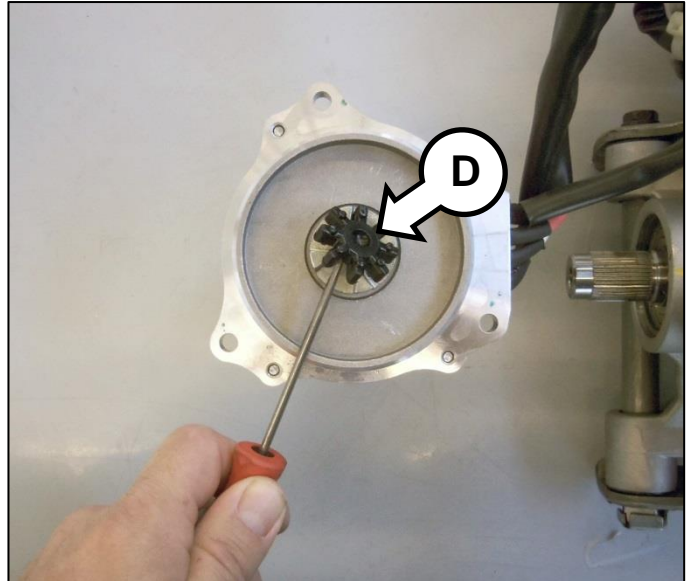

5. Install the new flexible coupling (E) onto the MDPS motor, as shown.

*** NOTICE**

Before installing the new flexible coupling, make sure it has "HNBR" embossed on the surface.

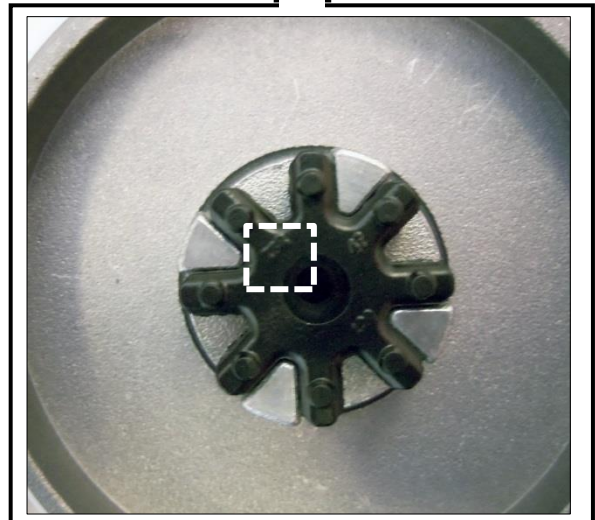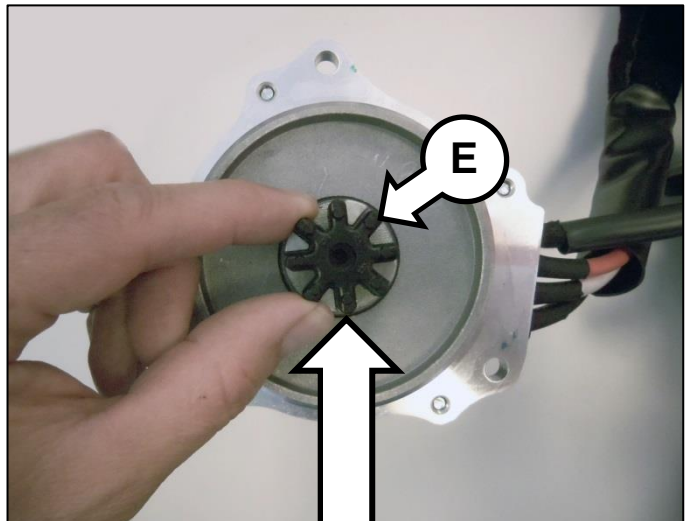

SUBJECT:

MDPS FLEXIBLE COUPLING REPLACEMENT


*** NOTICE**

Before re-installing the MDPS unit, make sure the steering wheel is aligned to the center position, with the front wheels pointing straight ahead.

- Reinstall all removed components by reversing the order of removal. Perform **Calibration Procedure**.

Calibration Procedure used after procedure 1 and 3 ONLY:

- Connect the power supply cable to the GDS.
- Connect the USB cable between the VCI and the GDS.
- Connect the Main 16-pin DLC cable (GHDM – 241000) to the VCI.
- Connect the Main 16-pin DLC cable (GHDM – 241000) to the OBD-II connector, located under the driver's side of the instrument panel.

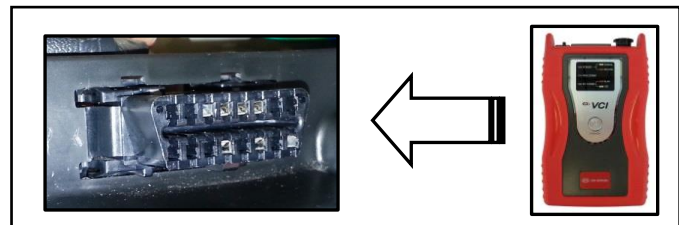


- Select **EPS** and click on **OK**.




SUBJECT:**MDPS FLEXIBLE COUPLING REPLACEMENT**


6. Select **Option Treatment** under the Vehicle S/W Management tab.

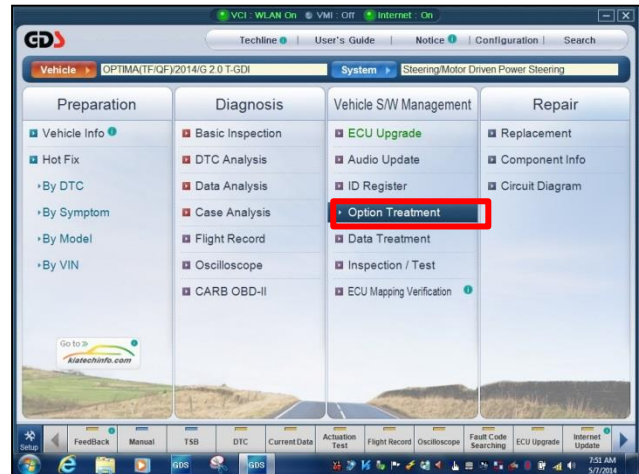

7. Select **ASP Calibration**.

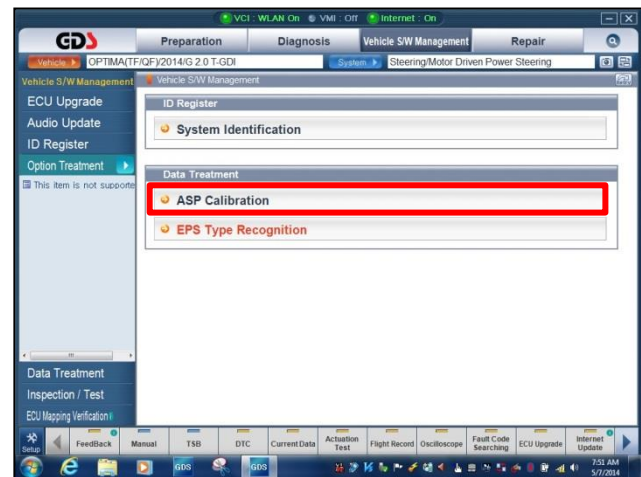


8. Click **OK** to continue with ASP calibration.

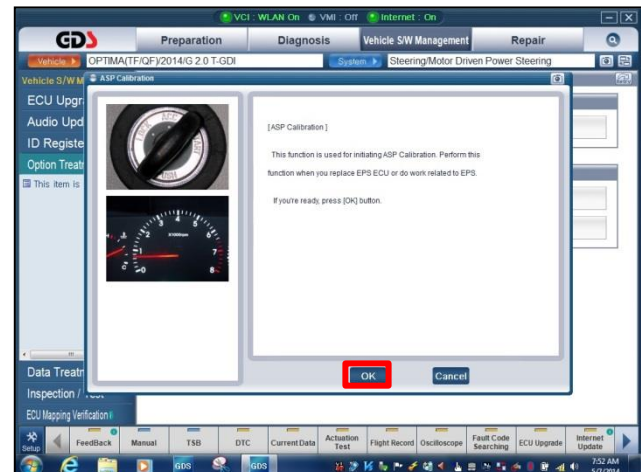


SUBJECT:**MDPS FLEXIBLE COUPLING REPLACEMENT**


9. Start the engine and center the steering wheel. Then, click **OK**.

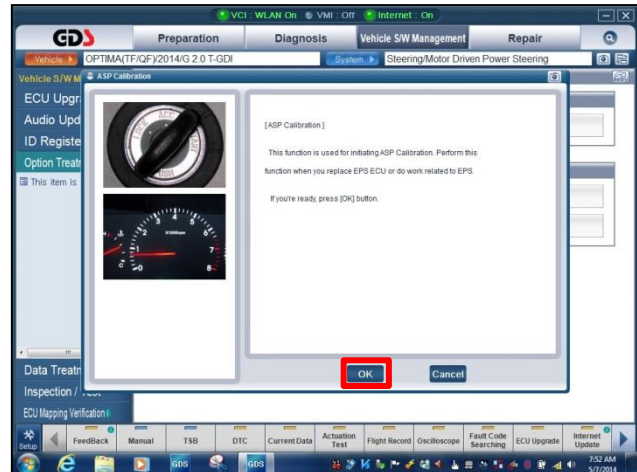

10. Turn the ignition **OFF** and wait 15 seconds. Then, turn the ignition **ON** and click **OK**.

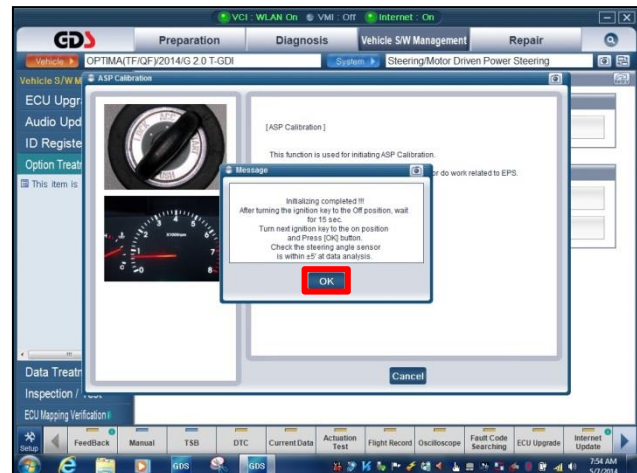


11. Access **Current Data** and verify the Steering Angle Sensor value is at 0.0 ± 5.0 degrees.

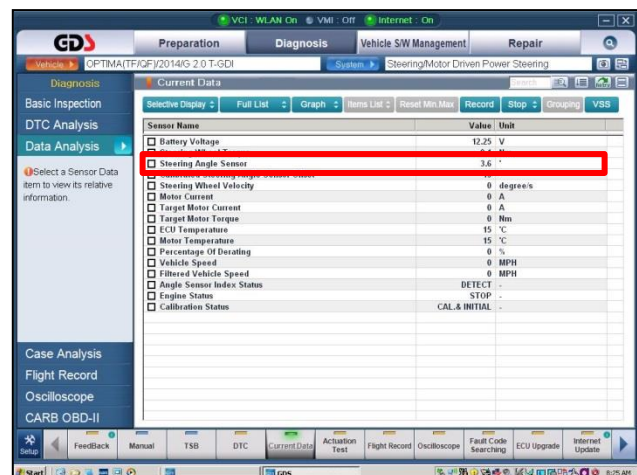

SUBJECT:**MDPS FLEXIBLE COUPLING REPLACEMENT****AFFECTED VEHICLE PRODUCTION RANGE:**

Model	Applicable Production Range
Forte (TD) 2012~2013	Jan. 05, 2012 ~ Mar.31, 2013
Forte (YD) 2014	Jan. 7, 2013 ~ Dec.18, 2013
Soul (AM) 2010~2013	Sep. 01, 2009 ~ Aug. 15, 2013
Cadenza (VG) 2014	Feb. 01, 2013 ~ Apr.19, 2014

PART INFORMATION:

Part Name	Part No.	Qty.	Replacement Part
Flexible Coupling	56315 2K000FFF	1	

WARRANTY INFORMATION:**N CODE = N29 C CODE = C63**

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	QTY.
Soul (AM)	W	56310 2K625	0	(CHA 074) MDPS Flexible Coupling Replace	56315F00	1.0 M/H	56315 2K000FFF	1
Forte (TD)		56310 1M550			56315F02	1.6 M/H		
Cadenza (VG)		56310 3R561				1.5 M/H		
Forte (YD)		56310 A7410				0.8 M/H		

★ NOTICE

The repair procedure to replace the flexible coupling of the MDPS Soul (AM) and Forte (YD) has been modified from the original repair procedure outlined in KGIS and previously in TSB CHA 044 (removal of certain parts as currently shown in the service procedure on KGIS is not necessary to complete the replacement of the flexible coupling). As a result, the labor time for the repairs for these models (includes inspection) have been adjusted.