

© 2016 Mazda Motor of America, Inc.


Subject: CONSOLE MAT WARPING CAUSING POOR APPEARANCE	Bulletin No: 09-019/16
	Last Issued: 03/24/2016

APPLICABLE MODEL(S)/VINS


2016 MX-5 vehicles with VINs lower than JM1ND*****103512 (produced before July 9, 2015)

DESCRIPTION

Some vehicles operating in places with high ambient temperatures may exhibit the console mat warping at the center part (A), causing a poor appearance. The console mat is fixed at both ends and warpage of the center part is caused by heat influence.

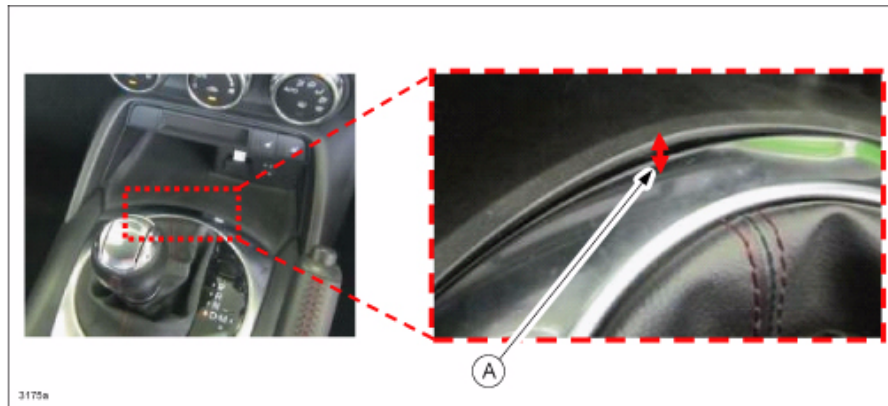

To prevent the console mat from warping, double-sided adhesive tape (A) has been added between the console mat (B) and the console panel (C).

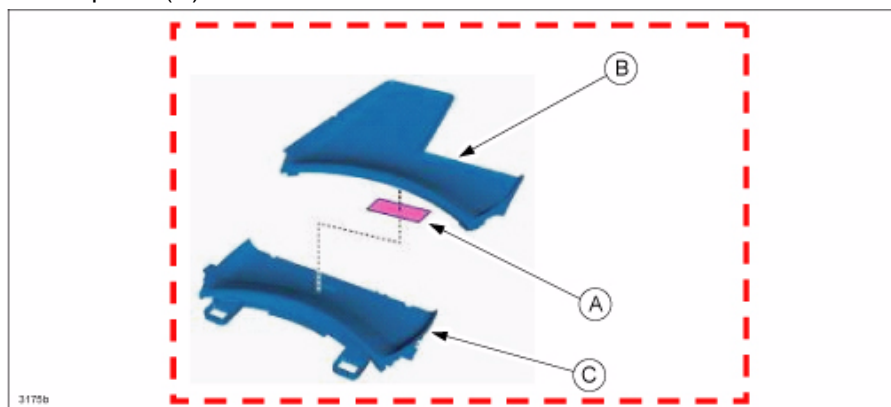

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the front console box assembly with a modified one according to the instructions on MS3 online or the Workshop Manual (section 09-17 CONSOLE PANEL REMOVAL/INSTALLATION).
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
N243-64-360	Box Console	1	For AT/MT

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	87 (Split/cut/warp)
Damage Code	9B (Warped)
Part Number Main Cause / Qty.	N243-64-360 / 1
Operation Number / Labor Hours:	XXL91XRX / 0.2 Hrs.