



Technical Service Bulletin

90 Outside temperature display in instrument cluster is incorrect

90 16 73 2046346/1 December 22, 2016.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|------|-----------|----------------------------|
| A4 | 2017 | All | Analog Instrument Cluster |

Condition

Complaint about the outside temperature display in the instrument cluster. The analog instrument clusters (PR numbers 9S7 and 9S5) are affected.

- After a longer stationary period the outside temperature display in the instrument cluster may show temperatures around 32.0°F (0.0°C) although it is clearly warmer.

Technical Background

Incorrect software.

Production Solution

Optimized software version 0361.



Technical Service Bulletin

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the Instrument Cluster Control Module (J285) (address word 0017) using the SVM action code as listed in the table below if necessary:

| Model | Old Software Part Number | Old Software Version | New Software Part Number | New Software Version (or higher) | SVM Code Input |
|-------|--------------------------|----------------------|--------------------------|-------------------------------------|----------------|
| A4 | 8W5920740 | <0339 | 8W5920740 | 0361 | TPKWW361B9 |

Warranty

| | | | |
|-------------------------|---|--------------|--|
| Claim Type: | <ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | |
| Service Number: | 9025 | | |
| Damage Code: | 0039 | | |
| Diagnostic Time: | GFF | 0150 0000 | Time stated on diagnostic protocol (Max 70 TU) |
| | Road test prior to service procedure | No allowance | 00 TU |
| | Road test after service procedure | 0121 0004 | 10 TU |
| | Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details) | | |



Technical Service Bulletin

| | |
|-----------------------|-----------------------|
| Claim Comment: | As per TSB #2046346/1 |
|-----------------------|-----------------------|

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2046346) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2016 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.