



## SERVICE BULLETIN

Classification:

EL16-026

Reference:

NTB16-071

Date:

July 27, 2016

### 2004-2014 ARMADA; POWER BACK DOOR INOPERATIVE AND BOLT ON POWER BACK DOOR OPENER LOOSE

**APPLIED VEHICLE:** 2004-2014 Armada (TA60)

#### IF YOU CONFIRM

- The power back door will not open or close when using any power open/close switch.

And

- The linkage for power back door has a loose or missing hex bolt (Figure 1).



Figure 1

#### ACTION

1. Replace the bolt shown in Figure 1 with a new bolt from the Parts Information.

- Do not reuse the old bolt.
- Clean the threads in the linkage before installing the new bolt.
- Install the new bolt and torque to 7 N•m (0.7 kg-m, **62 in-lb.**).

**NOTE:** Refer to the Electronic Service Manual (ESM), section **DLK – Door & Lock** to gain access to the power back door linkage bolt.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Power Back Door Opener Bolt	01131-0001U	1

## CLAIMS INFORMATION

**Submit a Primary Part (PP) type line claim using the following claims coding:**

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Power Back Door Opener Bolt	(1)	BX6AAA	ZE	32	0.7

(1) Refer to the electronic parts catalog and use the Back Door Closure Motor (82580-XXXXX) as the PFP.