



Technical Service Bulletin

SUBJECT:		No: TSB-16-51-001	
WIND NOISE FROM DOOR MIRROR		DATE: October, 2016	
		MODEL: 2015-16 Lancer models	
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

PURPOSE

A customer may report wind noise while driving at high speeds. This may be due to an improper clearance between the door panel and the door mirror, caused by incorrect placement of the positioning clip in the door mirror during production.

This TSB instructs dealers how to remove the positioning clip from the door mirror assembly, and how to properly reinstall the door mirror assembly.

AFFECTED VEHICLES

2015 – 2016 Lancer and Lancer Sportback vehicles built **before** February 25, 2016.


2015 Lancer Evolution vehicles.

REPAIR PROCEDURE



Use all tools with care to prevent scratches.


1. Remove the door mirror from the vehicle following Service Manual procedures.

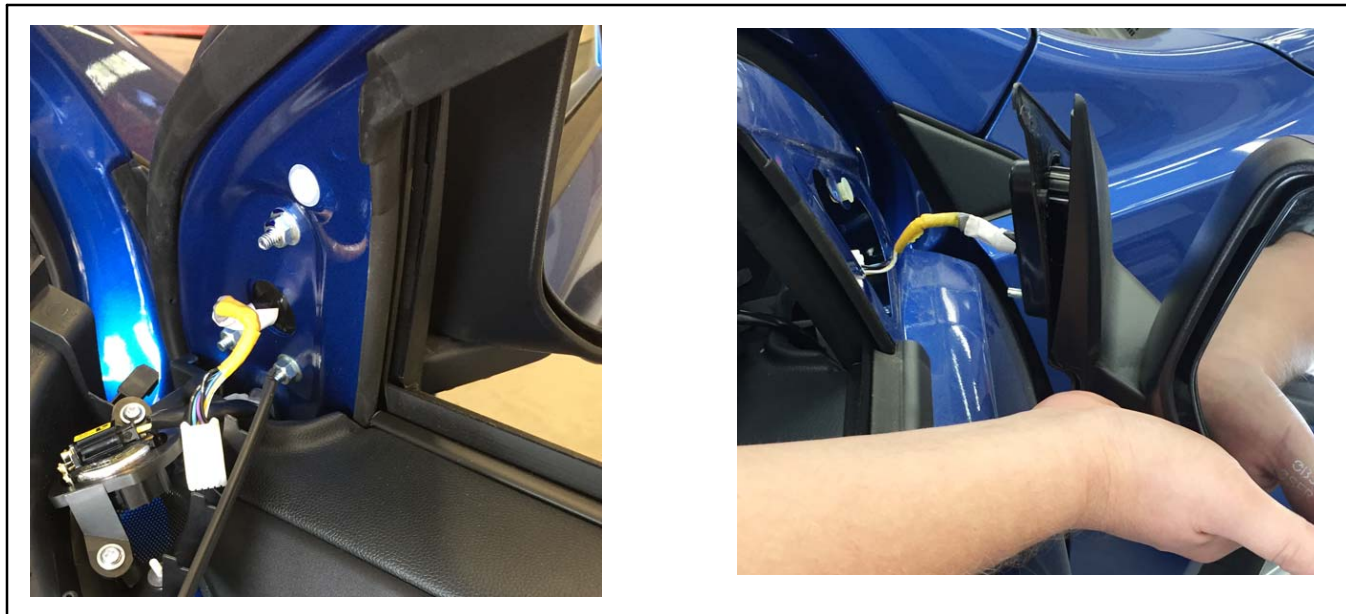


2. Once the door mirror is removed, locate the positioning clip.

NOTE: The positioning clip is often located in the door sheet metal after installation. The original position is in the mirror base as shown below.

3. Remove the positioning clip and discard.

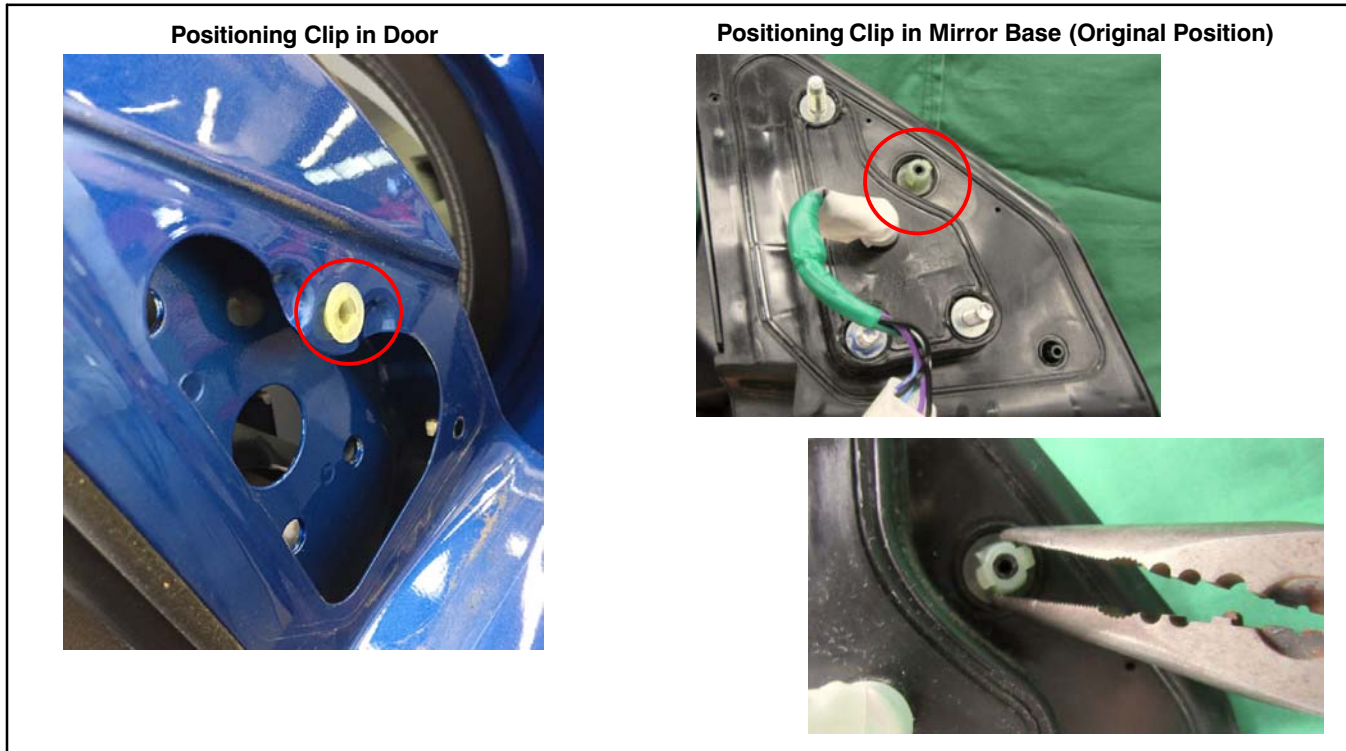

4. Reinstall the door mirror assembly onto the door panel.
Be sure to align the door mirror base along the door panel line (red oval area) as shown below.
Do NOT allow the mirror assembly to overlap the edge when installed.

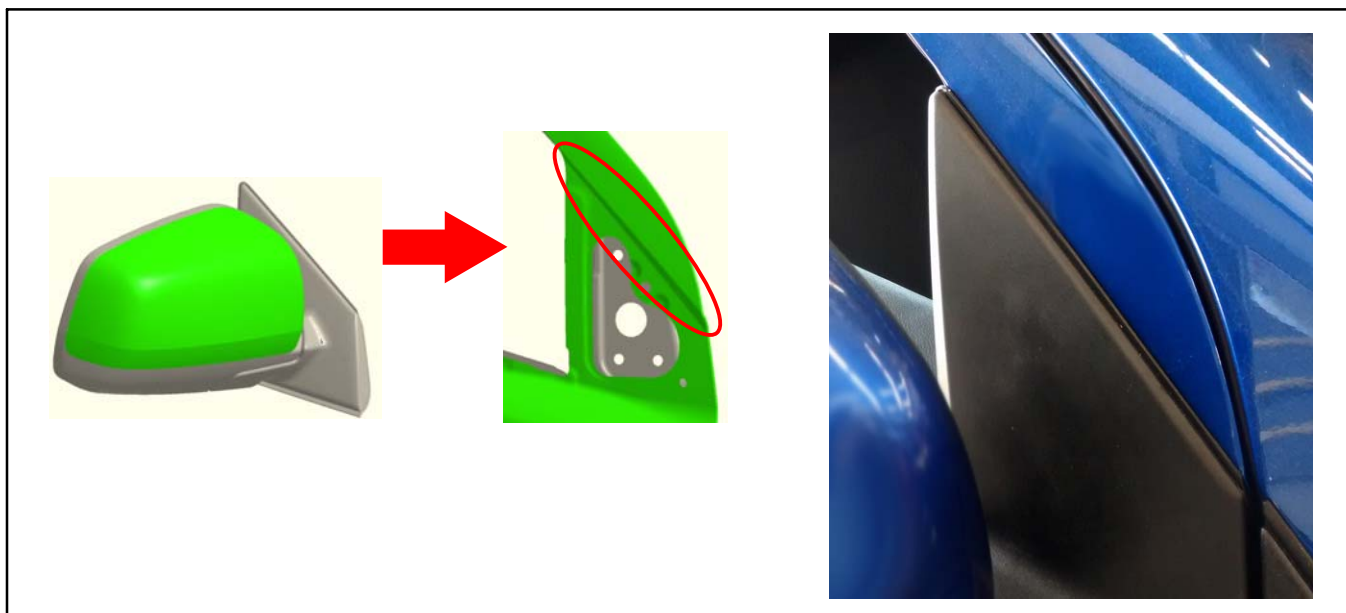

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim using the following information.

Labor Operation Code	Nature Code	Cause Code	Time Allowance
513010 NS	43M	170	One Side: 0.3 hrs
			Both Sides: 0.4 hrs

Warranty Coverage: Basic Coverage