



---

# SERVICE BULLETIN

---

Classification:

BT16-009

Reference:

NTB16-075

Date:

August 4, 2016

---

## 2015 – 2016 SENTRA; WIND NOISE FROM A-PILLAR OR FRONT DOOR AREA

**APPLIED VEHICLES:** 2015-2016 Sentra (B17)

**APPLIED VIN / DATE:** If the 11th digit of the VIN is a Y:

2015 built on or **after** 3N1AB7AP(\*)FY 277437 / Jan. 1, 2015

2016 built on or **before** 3N1AB7AP(\*)GY 284691 / May 20, 2016

If the 11th digit of the VIN is a L:

2015 built on or **after** 3N1AB7AP(\*)FL 634886 / Jan. 5, 2015

2016 built on or **before** 3N1AB7AP(\*)GL 665361 / May 23, 2016

### IF YOU CONFIRM

A wind noise coming from the front A-pillar or front door area that has the following characteristics:

- May be described as a howling, a honk, or a “burrrrrrp” type sound.
- It is usually not consistent, but intermittent.
- Is most prevalent during cross wind conditions.
- Can occur at various speeds, but usually occurs between 50 – 80 mph.
- If this noise occurs, it may be heard coming from the left side, the right side, or both sides.

### ACTION

Replace the front door weather-strip(s):

- If noise is coming from one side, replace weather-strip on only one side (left or right).
- If noise is coming from both sides, replace weather strip on both sides.

**IMPORTANT:** The purpose of “ACTION” (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire Service Procedure as it contains information that is essential to successfully completing the repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## SERVICE PROCEDURE

### NOTE:

- If noise is coming from one side, replace weather-strip on only one side (left or right).
- If noise is coming from both sides, replace weather-strip on both sides.
- Photos in this bulletin are of the driver's door, the front passenger door is a mirror image.

1. Unclip the weather-strip from the front edge of the door as shown in Figure 1.
  - There are 3 snap-in clips in this area.
  - Use a suitable plastic trim tool as needed.
  - Weather-strip is shown already unclipped in Figure 1.



Figure 1

2. Pull the weather-strip loose from its channel across the top of the door and part way down the back of the door.



Figure 2

3. Unclip the weather-strip from the back, bottom, and front of the door.
  - Use a suitable plastic trim tool.



Figure 3

4. Install the new weather-strip in reverse order of removal.
  - Make sure the weather-strip is properly secured in its channel across the top of the door.
  - Make sure all of the weather-strip clips are properly snapped in place.

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
Front Door Weather Strip RH	80830 - 4AF0A	1
Front Door Weather Strip LH	80831 - 4AF0A	1

## CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL ONE DOOR WEATHER-STRIP	(1)	UH14AA	ZE	32	(2)

- (1) Refer to the Parts Information and use the correct Front Door Weather Strip part number as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.

**NOTE:** If **both** sides are replaced claim operation code 2 times on the same repair line.