

## Technical Service Bulletin

40 Noises from front shock bellows when steering or when the front suspension is compressed

40 16 52 2044060/1 May 5, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3	2015 - 2016	All	Without Audi magnetic ride
TT	2016	All	Without Audi magnetic ride

#### Condition

Before proceeding, note that this bulletin does not apply to vehicles equipped with Audi magnetic ride.

- Customer may report hearing squeaking/creaking or rattling noises from front end when steering or when the front suspension is compressed.
- The noise can be reproduced in the workshop and is heard from the upper section of the front suspension strut.

### **Technical Background**

The front shock protective cover (or "bellows") can be deformed or incorrectly positioned for various reasons (such as improperly seated transportation blocks or improper installation after repairs), and as a result, can make noises in the upper section of the suspension strut (Figure 1).



**Figure 1.** Front shock assembly with front shock protective cover highlighted.

# Audi

# Technical Service Bulletin

#### **Production Solution**

Not applicable.

#### Service

- 1. Check the front shock protective covers for correct fit:
  - Properly-installed front shock protective covers should turn easily in the deep-grove ball bearings (Figure 2).
  - Improperly-installed front shock protective covers will not turn in the deep-groove ball bearings (Figure 3).


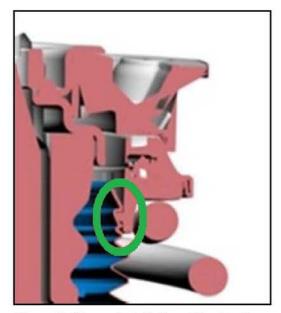


Figure 2. Proper installation of the front shock protective cover.



**Figure 3.** Improper installation of the front shock protective cover.

 Repair by repositioning the front shock protective covers so that they are installed correctly, as shown (Figure 2).
 If the front shock protective cover cannot be reinstalled correctly due to permanent damage or deformation, it must be replaced.

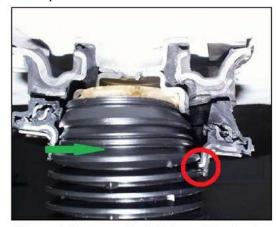

# Technical Service Bulletin

## Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warra Bulletin is informational only.	anty, this Technic	al Service		
Service Number:	4091				
Damage Code:	0017 Reinstall front shock protective cover(s) or 0010 Replace front shock protective cover(s)				
Labor Operations:	Scenario 1: Check and reinstall only				
(Only one of the four scenarios can be	Check and reinstall 1 or 2 protective covers	4091 0699	40 TU		
claimed.)	Scenario 2: Replace the left front protective cover				
	Suspension strut remove+reinstall	4085 1901	150 TU		
	Replace protective cover	4091 5699	30 TU		
	Scenario 3: Replace the right front protective cover				
	Suspension strut remove+reinstall	4085 1902	210 TU		
	Replace protective cover	4091 5699	30 TU		
	Scenario 4: Replace two protective cover (two shocks)				
	2 Suspension struts remove+reinstall	4085 2002	290 TU		
	Replace 2 protective covers	4091 5599	50 TU		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to service procedure	0121 0002	10 TU		
	Road test after service procedure	0121 0004	10 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)				
Claim Comment:	As per TSB #2044060/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

## **Required Parts and Tools**

If the front shock protective cover cannot be properly reinstalled due to permanent damage or deformation it must be replaced. Claims with undamaged parts will be denied.

Part Number	Part Description	Quantity
5Q0413175C	Protective covers (bellows)	1 or 2

#### **Additional Information**

All parts and service references provided in this TSB (2044060) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.