Service Bulletin Mazda North American Operations

Irvine, CA 92618-2922



© 2016 Mazda Motor of America, Inc.

Subject:	Bulletin No:	01-011/16
ROUGH IDLE AND/OR MIL ON WITH DTC P0300, P0301, P0302, P0303 OR P0304		
IN COLD TEMPERATURE	Last Issued:	04/15/2016

APPLICABLE MODEL(S)/VINS

2014-2016 Mazda6 2013-2016 CX-5

DESCRIPTION

When the engine is started for the first time after parking the vehicle overnight in cold conditions (below zero degrees Celsius), some vehicles may exhibit a rough idle and/or the check engine light on with any of the following DTC(s) stored in memory.

- P0300 Random misfire detected
- P0301 Cylinder No.1 misfire detected
- P0302 Cylinder No.2 misfire detected
- P0303 Cylinder No.3 misfire detected
- P0304 Cylinder No.4 misfire detected

This may be caused by frozen water accumulated in the main silencer, restricting exhaust flow.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern of water accumulated and frozen in the main silencer and the tail pipe.



- 2. Replace the main silencer. Refer to MS3 online or Workshop Manual section 01-15:
 - Mazda6 EXHAUST SYSTEM REMOVAL/INSTALLATION [SKYACTIV-G 2.5]
 - CX-5 EXHAUST SYSTEM REMOVAL/INSTALLATION [SKYACTIV-G 2.0, SKYACTIV-G 2.5]
- 3. Inspect the engine oil level. If the engine oil level is above the F mark, replace the engine oil.
- 4. Erase any stored DTC(s).
- 5. Verify repair.

Page 1 of 2

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
PYY3-40-100	SILENCER ASSY-MAIN	1	Mazda6
PEY6-40-100	SILENCER ASSY-MAIN	1	CX-5 2.0L
PYY1-40-100	SILENCER ASSY-MAIN	1	CX-5 2.5L 2WD
PYY2-40-100	SILENCER ASSY-MAIN	1	CX-5 2.5L 4WD
PE23-40-305	GASKET-EXH PIPE	1	
9994-61-000	NUT-SELFLOCK	2	

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

	Replace main silencer	Replace main silencer and engine oil	
Warranty Type	A		
Symptom Code	03		
Damage Code	9W		
Diagnostic Trouble Code (DTC)	P0300, P0301, P0302, P0303, or P0304		
Part Number Main Cause	****-40-100		
Quantity	1		
Operation Number / Labor Hours:	XXM1GARX / 0.4 Hrs.	XXM1GBRX / 0.6 Hrs.	

NOTE: Warranty claim submission will require entry of a valid DTC.