

© 2016 Mazda Motor of America, Inc.

Subject: UNUSUAL STEERING NOISE AND / OR VIBRATION WHEN TURNING	Bulletin No: 06-002/16
	Last Issued: 04/29/2016

APPLICABLE MODEL(S)/VINS

2016 Mazda2 vehicles with VINs lower than 3MD DJ ***** 106153 (produced before January 18, 2016)

2016 CX-3 vehicles with VINs lower than JM1 DK ***** 133287 (produced before January 21, 2016)

DESCRIPTION


Some vehicles may exhibit an unusual noise from around the driver's foot area when repeatedly turning the steering wheel to the left or right. A vibration is felt at the steering wheel when the noise occurs.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the intermediate shaft (B). Refer to MS3 online "INTERMEDIATE SHAFT REMOVAL/INSTALLATION".

NOTE: Replace joint bolts A (Replacement part) with new ones.

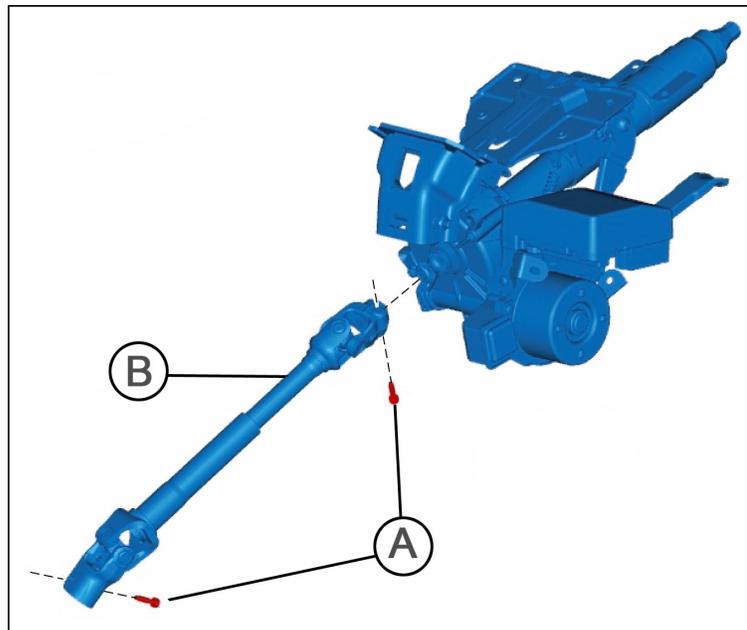


3. Test drive to confirm noise concern has been resolved and the steering wheel is straight.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
DA6A-32-090B	Intermediate Shaft	1	Mazda2
DB2W-32-090	Intermediate Shaft	1	CX-3
B455-32-099B	Joint Bolt A	2	---

The intermediate shafts with the production date after October 28, 2015 are modified.

The image shows a production date of August 5, 2015 (D) as an example.

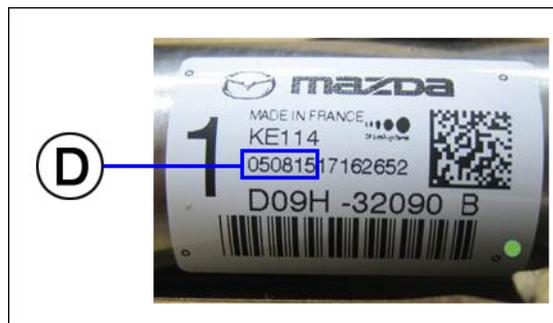

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	9G
Part Number Main Cause	**** 32 090*
Quantity	1
Operation Number / Labor Hours:	XXM2SXRX / 0.2 Hrs.