

Technical Service Bulletin



01 Camshaft adjuster implausible signal

01 16 58 2043735/2 April 12, 2016. Supersedes Technical Service Bulletin Group 15 number 16-27 dated March 23, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3	2015 - 2016	All	2.0L engine
A6, TT	2016	All	2.0L engine

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Corrected DTC)
1	3/23/2016	Initial publication

- MIL on.
- Customer complains of occasional poor performance and that cruise control does not always work.
- One of the following DTCs for cam shift actuator "A" or "B" cylinder range/performance is stored in the engine control module, J623 (address word 01):
 - DTC P11A200 (Cam shift actuator "A" cylinder 1 - range/performance)
 - DTC P11A400 (Cam shift actuator "B" cylinder 1 - range/performance)
 - DTC P11A600 (Cam shift actuator "A" cylinder 2 - range/performance)
 - DTC P11A800 (Cam shift actuator "B" cylinder 2 - range/performance)
 - DTC P11AA00 (Cam shift actuator "A" cylinder 3 - range/performance)
 - DTC P11AC00 (Cam shift actuator "B" cylinder 3 - range/performance)
 - DTC P11AE00 (Cam shift actuator "A" cylinder 4 - range/performance)
 - DTC P11B000 (Cam shift actuator "B" cylinder 4 - range/performance)

Technical Background

Malfunction of the camshaft adjuster of the Audi valvelift system.

Production Solution

Not applicable.

Technical Service Bulletin



Service

1. Proceed according to Guided Fault Finding
2. Replace the affected actuator with part number 06E103697L.

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	1551		
Damage Code:	0040		
Labor Operations:	Adjusting mechanism for valvelift system remove+reinstall	1551 2015	70 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 50 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2043735/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
06E103697L	Adjuster unit	1

Additional Information

All parts and service references provided in this TSB (2043735) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.