

Technical Service Bulletin



20 MIL on (DTC P046100 - Fuel level sensor, circuit range/performance)

20 16 67 2043357/1 April 22, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A5, A5 Cabriolet, Q5	2013 - 2016	All	2.0L engine
Q5	2015 - 2016	All	Hybrid engine

Condition

- MIL on.
- DTC P046100 (Fuel level sensor, circuit range/performance) is stored in the engine control module (ECM J623).

Technical Background

DTC P046100 can be caused by miscalculations within the ECM software when the vehicle is being filled with gasoline while the ignition is on.

Production Solution

New ECM software implemented to correct the condition.

Service

IMPORTANT: The following instructions apply to vehicles with 2.0L engines only.

SVM Update Instructions

1. Follow all instructions in TSB 2011732, *00 Software Version Management (SVM), operating instructions*.
2. Update the ECM (J623) using the SVM action code as listed in the table below.
3. After SVM update, cycle the ignition.
4. Start the engine. If engine runs rough and then surges, cycle the ignition once again.
5. Reset TPMS.

Technical Service Bulletin



Model	Engine	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version	SVM Code Input
A4,A5,A5 cabriolet	2.0 TFSI	8K5907115N	0001/0002/0003	8K5907115N	0004	01A203
A4,A5,A5 cabriolet	2.0 TFSI	8K5907115J	0001/0002	8K5907115N	0004	01A203
A4,A5,A5 cabriolet	2.0 TFSI	8K5907115P	0001	8K5907115P	0002	01A203
A4,A5,A5 cabriolet	2.0 TFSI	8K5907115M	0001/0002/0003	8K5907115M	0004	01A203
A4,A5,A5 cabriolet	2.0 TFSI	8K5907115Q	0001	8K5907115Q	0002	01A203
Q5	2.0 TFSI	8R1907115N	0001	8R1907115N	0002	01A203
Q5	2.0 TFSI	8R1907115P	0001	8R1907115P	0002	01A203
Q5	2.0 TFSI H	8R1907115L	0001/0002/0003	8R1907115L	0004	01A203
Q5	2.0 TFSI H	8R1907115M	0001/0002	8R1907115M	0003	01A203
Q5	2.0 TFSI	8R1907115F	0001	8R1907115L	0004	01A203

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Check software level in ECM and perform update	2470 2599	Max 40 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2043357/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2043357) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.