

# Technical Service Bulletin



## 70 Noises from headliner / sunroof area

70 16 51 2044417/1 June 3, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q7	2017	000001 - 005307	Not Applicable

## Condition

The customer hears a rattle from the headliner area.

## Technical Background

The noises can be caused by movement in the clips that attach the headliner to the sunroof frame.

## Production Solution

Felt material has been added to points of contact on the clips in production.

## Service

1. Test drive the vehicle (preferably with the customer) and duplicate the noise. Applying pressure to areas of the headliner around the perimeter of the sunroof will eliminate the noise, confirming the root cause.
2. Remove the headliner. The clips shown in the illustration will need fleece adhesive tape (D 373125A2) (Figure 1).



*Figure 1. Location of the headliner to sunroof frame clips.*

3. Remove the clips and apply the fleece adhesive tape underneath them, as shown (Figure 2).



*Figure 2. Location of the fleece adhesive tape application.*

4. Reinstall the clips (Figure 3).

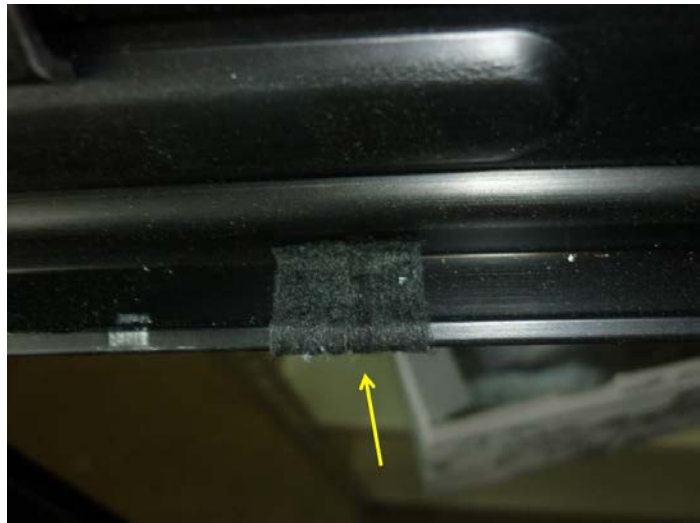


*Figure 3. Clips reinstalled.*

# Technical Service Bulletin



- Finally, apply fleece adhesive tape to the sunroof frame lip at each clipping point (Figure 4).



**Figure 4.** Application area on sunroof frame area of clip engagement.

- Perform a final test drive to confirm that the noise has been eliminated.

## Warranty

<b>Claim Type:</b>	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	7084		
<b>Damage Code:</b>	0020		
<b>Labor Operations:</b>	Headliner remove+reinstall	7084 1900	330 TU
	Apply fleece tape to headliner clips	7084 9999	30 TU
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2044417/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

# Technical Service Bulletin



## Required Parts and Tools

Part Number	Part Description	Quantity
D 373125A2	 Fleece Adhesive Tape	0.1

## Additional Information

All parts and service references provided in this TSB (2044417) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.