

SSM 46250	<p>Some 2017 F-Super Duty chassis cab and pickup box delete vehicles built on or before 27-Sep-2016 may exhibit an instrument panel cluster (IPC) turn signal indicator flashing fast with no inoperative turn signal lamps. This may be due to the body control module (BCM) not recognizing the usage of modified turn signal lighting which draws lower current and is detected as an inoperative turn signal lamp. To correct this concern, use Integrated Diagnostic System (IDS) service tool version 103.03 or later to configure the front and rear turn lamp outage settings as required. These settings can be found under toolbox > module programming > programmable parameters > exterior lighting. Use causal part 15604 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.</p>
--------------	--