

Reference	SSM72936
Models	XE / X760 XF / X260
Title	Camshaft Sensor Fault and MIL Illuminated (P0341-91)
Category	Engine
Last modified	18-Aug-2016 00:00:00
Symptom	499000 Basic Engine

Content **Issue:** A Customer may express a concern that the Check Engine Light is illuminated (MIL) with DTC P0341-91 is stored in the Powertrain Control Module (PCM) on Ingenium 2.0 Diesel (AJ200D) engines only.

Cause: Diagnostic Trouble Code (DTC) P0341-91 parameters are too sensitive.

Action: Updated PCM software is available for the VIN ranges below on SDD on DVD146.6, however this has not been symptom mapped. Please complete the Existing Module PCM update routine as this will rectify the issue.

XE (X760) - 900001 - 950318

XF (X260) - Y00001 - Y29703

Please Note - A Technical Service Bulletin (TSB) will be published late in August 2016, to coincide with DVD 146.07.