

<b>Reference</b>	SSM72878
<b>Models</b>	XF / X260
<b>Title</b>	The BCM shows four Critical Mismatches in the CCF
<b>Category</b>	Diagnostic Software Hardware
<b>Last modified</b>	03-Oct-2016 00:00:00
<b>Symptom</b>	000101 Diagnostic Concerns

**Content****Issue:**

After completing any modification to the Car Configuration File (CCF) on the vehicles mentioned in this SSM either of the two issues below can occur:

The Diagnostic Trouble Codes (DTCs) U2300-62 or U2300-54 is stored in the Body Control Module (BCM).

The CCF loaded into the BCM contains four critical mismatches related to the CCF assemblies for different modules.

**Cause:**

The two CCFs created for the BCM and Gateway Module (GWM) have different start and stop addresses, therefore the checksum of both files are different, which causes the DTCs to be logged in the BCM.

The four critical mismatches are currently being investigated, however they do not affect vehicle performance.

**Action:**

This Concern has been resolved on SDD\_146.06.001, therefore this SSM will be expired in 1 week.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.