

Technical Service Bulletin

24 Cruise control/adaptive cruise control intermittently do not work

24 16 56 2045049/1 August 15, 2016.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A3	2016 - 2017	All	e-tron	

Condition

- The cruise control or adaptive cruise control intermittently cannot be switched on when the vehicle is being driven.
- The complaint only occurs after the air conditioning is used.
- After the ignition is switched off and then switched on, the complaint is fixed.

Technical Background

The software in the engine control module (ECM), J623 (address word 01), needs to be updated.

Production Solution

Not applicable.

Service

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Update the ECM, J623 (address word 01), using the SVM action code as listed in the table below, if necessary.

Model	Engine	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
	CXUA	04E906023AF	< 3381	04E906023AF	3381	
A3 e-tron	CXUA	04E906023H	< 9258	04E906023H	9258	01A223
	CXUA	04E906023AB	< 3387	04E906023AB	3387	

© 2016 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

Claim Type:	 aim Type: 110 up to 48/50 G10 for CPO covered vehicles – verify owner If vehicle is outside any warranty, this Technical Service Bulletin is informational only 					
Service Number:	2470					
Damage Code:	0039					
Diagnostic Time:	Software update	0150 0000	Time stated on diagnostic protocol (Max 100 TU)			
	Technical diagnosis at dealer's disc (Refer to Section 2.2.1.2 and Audi V		nce details)			
Claim Comment:	aim Comment: As per TSB #2045049/1					

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

• TSB 2011732 00 Software Version Management (SVM), operating instructions.

All part and service references provided in this TSB (2045049) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.

© 2016 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.