

SSM 46171	<p>Some 2016 Edge/MKX vehicles may exhibit an illuminated adaptive/active steering fault message in the instrument panel cluster (IPC) message center with diagnostic trouble codes (DTCs) U3000, C2003, B137F, B1380, U210A, and U2000 stored in the SECM. If DTC U3000:96 is present, the SECM must be replaced. If DTC U3000:96 is not present, reprogram the SECM to the latest calibration using Integrated Diagnostic System (IDS) release 102.05 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com. Use causal part 3600 and applicable labor operations in section 10 of the Service Labor Time Standards (SLTS) manual.</p>
--------------	---