Service Bulletin

Bulletin No.: PIT5482A

Date: Feb-2016

# PRELIMINARY INFORMATION

Subject: Intermittently Service Front Camera Message With DTCs U023A and/or U026A

Models: 2016 Cadillac Escalade Models

2016 Chevrolet Malibu, Silverado, Suburban, Tahoe

2016 GMC Sierra, Yukon Models

## This PI was superseded to update Recommendation. Please discard PIT5482.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition/Concern

Some owners may comment that intermittently there is a "Service Front Camera" message on the DIC. When scanning for DTC's, a history U023A and/or U026A may be set in the IPC and/or BCM.

#### Recommendation/Instructions

**Important:** Do NOT replace the front view camera module for this condition.

Updated software has been released to correct this concern. Reprogram the frontview camera module (K109) with the latest software in TIS2WEB.

### **Warranty Information**

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2810835	Front View Camera Reprogramming with SPS	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION