

Reference	SSM72763
Models	XE / X760
Title	I.P. (Instrument Pack) Warning Light Illuminated
Category	Electrical
Last modified	17-May-2016 00:00:00
Symptom	206000 Warning Indicators
Content	Issue: A customer may report that a warning light is illuminated on the instrumenr pack, may effect vehicles up to vin. 950646. Cause: Possible poor earth connection at G1D129A/B/C. Action: If one or more of the above lamps are illuminated on the I.P. and Symptom Driven Diagnostics (SDD) guides the technician to carry out a number of continuity checks of the electrical circuits, check earth connector G1D129A/B/C (located in the front left hand side engine compartment) for continuity at the start of diagnosis. For reports beyond vin 950646 please submit an EPQR