

Reference	SSM72778
Models	F-PACE / X761
Title	X761 - F Pace Diesel Exhaust Fluid Leakage from filler bowl area
Category	Engine
Last modified	18-May-2016 00:00:00
Symptom	404000 Fuel System Concerns
Attachments	Image 1.jpg (Image 1.jpg) Image 2.JPG (Image 2.JPG) Image 4.JPG (Image 4.JPG) image3.JPG (image3.JPG)

Content

Issue:
Diesel Exhaust Fluid (DEF) leakage from Fuel Filler bowl area – This will be identified as white fluid staining on the right hand side of vehicle towards the rear. (See image 1)

Cause:
Incorrect fitment of DEF/Fuel filler bowl causing insufficient tightening of DEF filler cap. (See image 2)

Action:
Using a suitable trim tool (not a screwdriver or any other sharp implement) manipulate the lower rubber fuel bowl to locate on the correct collar of the DEF filler tube. (See image 3) Please note that the correct orientation of the rubber DEF bowl is below the collar on which the DEF Cap retaining ring is fitted – This is identified by the collar with the retaining ring tab. (see image 4)

This concern can affect vehicles within the VIN range below:
F-Pace **(HA)045000 to (HA)060252**







