

Reference	SSM72206
Models	F-TYPE / X152 XE / X760 XF / X250 XF / X260 XJ / X351
Title	Fault code F000-63/U3000-63 logged in the KVM (Keyless vehicle module)
Category	Electrical
Last modified	16-Feb-2016 00:00:00
Symptom	203000 Basic Electrical
Content	<p><u>Issue</u> Only applicable to software versions 30.3 (GEN 3) FK72-14C104-AF and 29.3 (GEN 2) DPLA-14C104-AG</p> <p>When checking for fault codes logged in the KVM (keyless vehicle module) also known as the RFA (remote function actuator) F000-63/U3000-63, Control Module - Circuit/ Component Protection Time-Out is logged.</p> <p><u>Cause</u> This DTC is set when the KVM has gone through a "self reset"</p> <p><u>Action</u> This DTC will not have any effect on functionality. The module must not be replaced .Please carryout a DTC clear. There is a possibility that it will keep appearing</p> <p>This was resolved from KVM software level 31.1 Please continue to carry out this procedure on affected vins.</p> <p>Assured vins XE 937182 XF (X260) Y10370 XJ V94874 F Type K33181</p>