
Reference	SSM72964
Models	Range Rover Evoque / L538 (166248 → 600000)
Title	L538+L538c - Water Leak into Front Footwells
Category	Electrical
Last modified	23-Sep-2016 00:00:00
Symptom	208999 Other Climate Controls Concerns
Content	<p><u>Issue:</u> The customer may express the concern that the carpet in one or both of the front passenger footwells is wet.</p> <p><u>Cause:</u> Poor connection of the HeVAC drain tube.</p> <p><u>Action:</u> Confirm the customer concern then:</p> <ul style="list-style-type: none">• Remove the front right side section of the Centre Console as per Topix 501-12 (Instrument Panel and Console).• Locate the drain tube on the side of the HeVAC unit.• Make sure that the tube is not twisted or kinked.• Ensure that the end of the drain tube is firmly secured into the cut out within the floor panel, beneath the footwell carpet. <p>Dry out the areas affected by the water ingress and reassemble.</p>