

Reference	SSM72978
Models	Range Rover / L405 Range Rover Sport / L494
Title	HDC and Stability Assist Unavailable Message on Instrument Cluster 16MYonwards
Category	Electrical
Last modified	27-Sep-2016 00:00:00
Symptom	206000 Warning Indicators
Content	<p>Issue: A customer may report an intermittent message 'Hill descent Control (HDC) and Stability Assist are unavailable' displayed on the Instrument Cluster. Affects Range Rover and Range Rover Sport 16MYonwards.</p> <p>The message can appear where the customer switches the ignition on only but doesn't start the engine until after a period of 32 seconds.</p> <p>The following DTC will have been logged:</p> <ul style="list-style-type: none">- U0140-87: Anti-Lock Brake System Control Module (ABS) Lost Communication with Body Control Module – missing message. The message will clear at the next ignition cycle. <p>Cause: This particular issue is caused by the ABS module not receiving all the required parameters from the Car Configuration File (CCF) within a 16 second time frame.</p> <p>Actions: Land Rover is currently carrying out revisions to the as-built file database for release on a future Symptom Driven Diagnostics, patch file. A suitable technical communication will be published when the new as-built files are available.</p>