

TECHNICAL BULLETIN

LTB00977NAS1

17 AUG 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-05

Rear Door Interior Trim Panel Loose

AFFECTED VEHICLE RANGE:

Range Rover Evoque (LV)

Model Year: 2014-2016**VIN:** 856580-160075

5-Door

Assembly Plant: Halewood

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The rear door interior trim panel(s) may appear loose and/or may be trapped in the rear door aperture secondary seal.

Cause: This may be caused by the pre-load onto the existing rear door interior trim panel clip being too high.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:

LR044885	Clip	1
LR013135	Clip	8

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear Interior Door Trim - Remove for Access and Refit	76-34-04-99	0.2	24	LR028137


 **NOTE:** Normal Warranty procedures apply.

SERVICE INSTRUCTION:

1. Remove the rear interior door trim panel (see TOPIx Workshop Manual section 501-05: Interior Trim and Ornamentation - Rear Door Trim Panel).


2.  **NOTE:** Rear right door trim panel shown; rear left similar.

Remove and discard the indicated interior door trim clip.

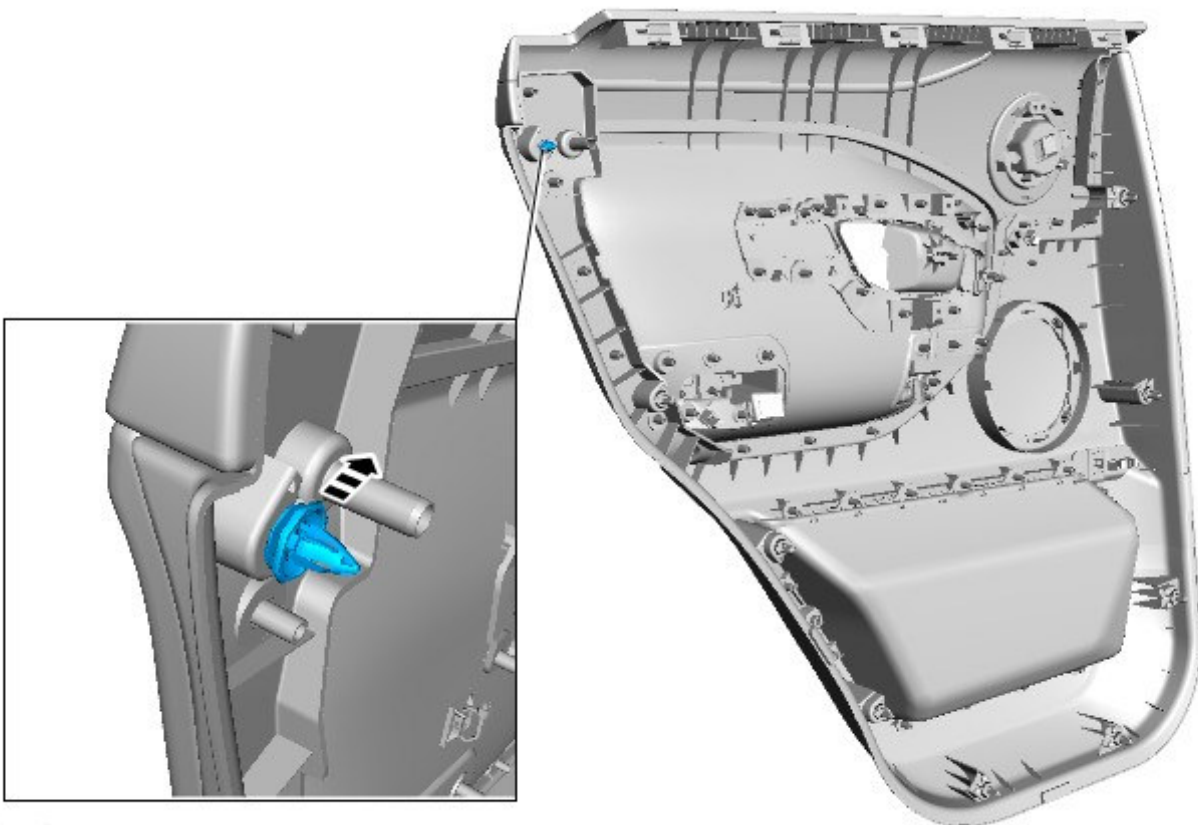

E194143

3. Install the new interior door trim clip (LR044885).

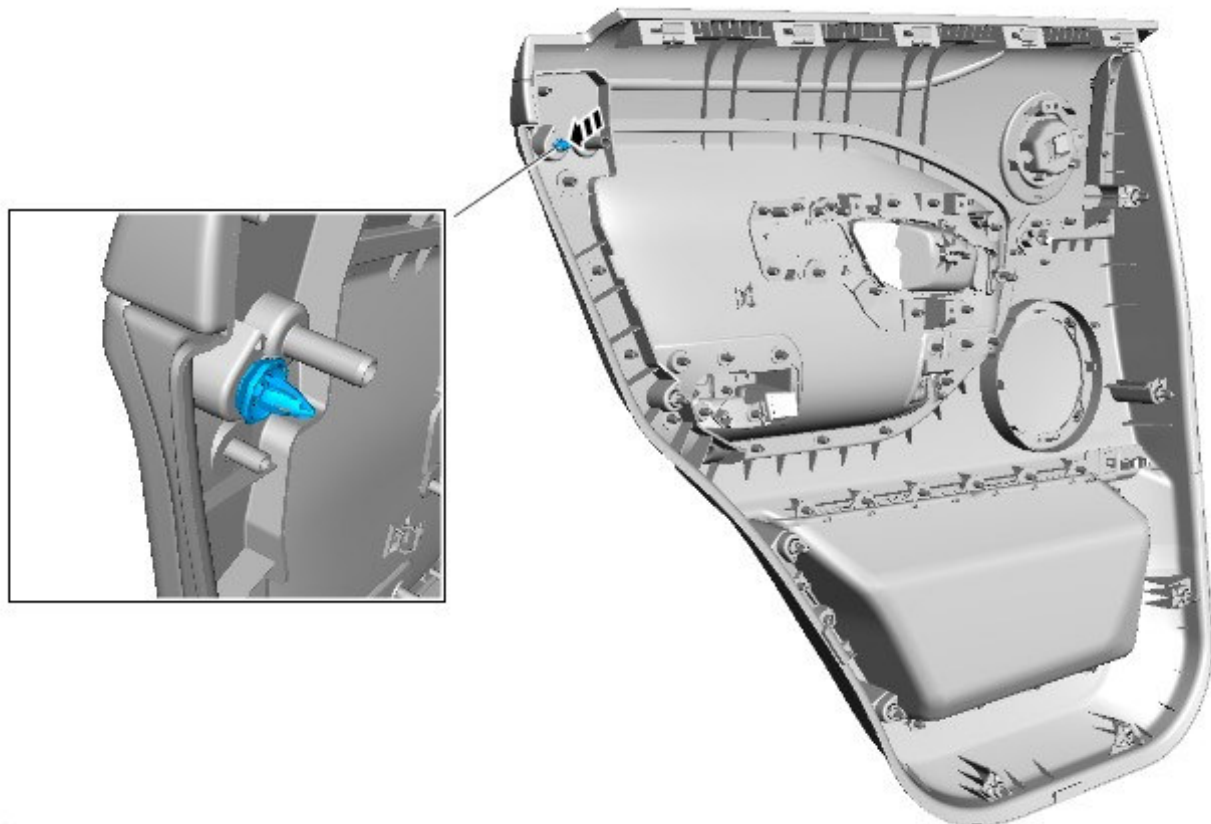


E194147

4.  **NOTE: Rear right door trim panel shown; rear left similar.**

Inspect the other eight interior door trim clips.

- Replace clips as necessary.

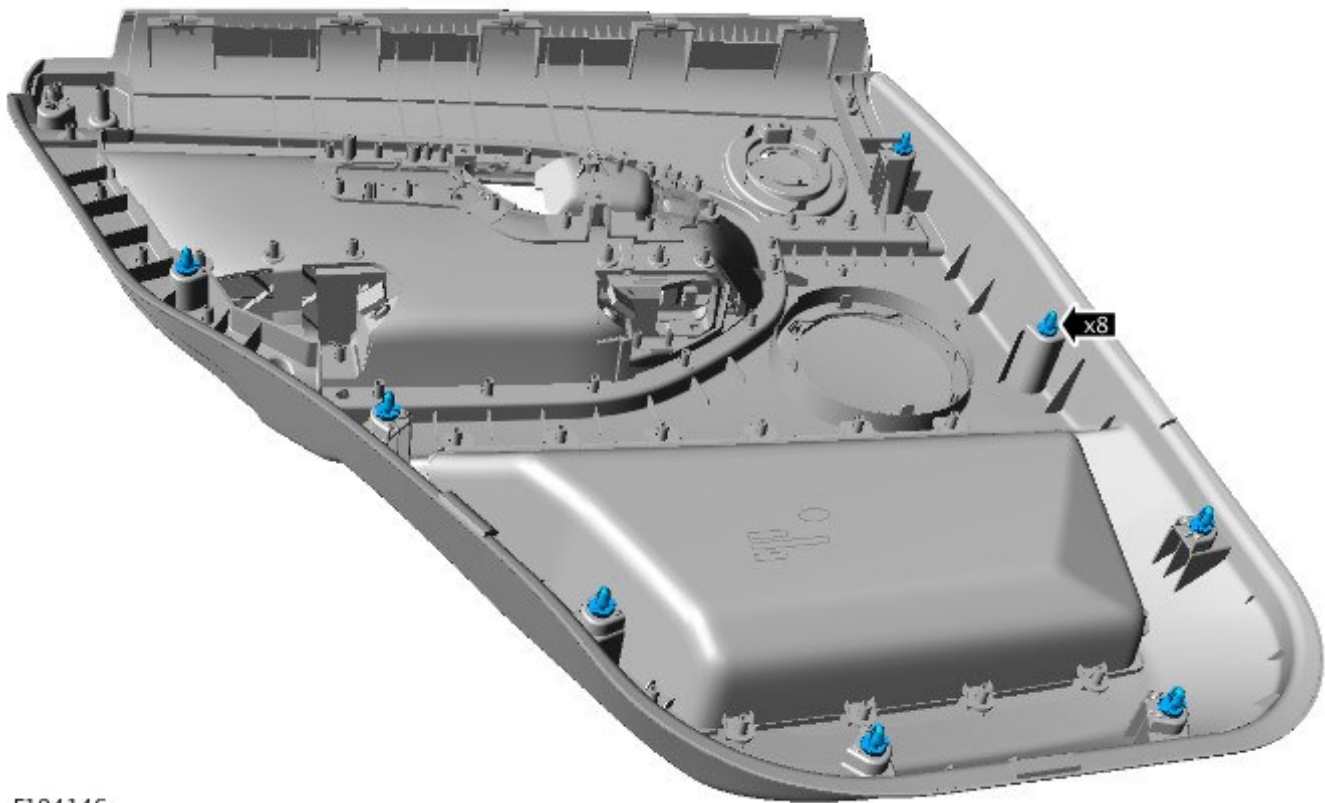

E194146

- 5.** Install the rear door interior trim panel (see TOPIx Workshop Manual section 501-05: Interior Trim and Ornamentation - Rear Door Trim Panel).