

December 8, 2016

05335 Version 1

Right Rear Seat Does Not Fold Properly

AFFECTED VEHICLES

Year	Model	Trim	VIN Range		
2015	CR-V	2WD	2HKRM3FH512304 thru END		
		2000	5J6RM3FL007921 thru END		
2013		AWD	2HKRM4FH620499 thru END		
			5J6RM4FL026962 thru END		
	CR-V	2WD	2HKRM3GH500001 thru 2HKRM3GH500271		
2016		2000	5J6RM3GL000001 thru 5J6RM3GL000564		
		AWD	2HKRM4GH600001 thru 2HKRM4GH600271		
			5J6RM4GL00001 thru 5J6RM4GL04441		

NOTE: Vehicles with VINs beginning with 3CZ, built in Mexico, are not affected.

BACKGROUND

When the right rear seat release lever is pulled, the seat bottom is slow to flip up, causing the rear seat to not fold correctly.

POSSIBLE CAUSE

The right rear lower seat bracket is binding.

CORRECTIVE ACTION

Adjust the seat bracket.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation	Description	Flat Rate	Defect	Symptom	Template	Failed Part
Number		Time	Code	Code	ID	Number
8533A2	Adjust the lower seat bracket.	0.4 hr	07403	03214	16-104A	82212-T0A-A01

Skill Level: Repair Technician

DIAGNOSIS

Check that the right rear seat (40 portion) folds properly by pulling the release lever.

- If the seat bottom is slow to fold up, causing the seat back to make contact and not complete the seat folding sequence, continue to REPAIR PROCEDURE.
- If the seat folds normally, this bulletin does not apply.

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE

1. Remove the right side rear seat cushion foot cover.



RIGHT SIDE REAR SEAT CUSHION FOOT COVER

2. Remove the right rear seat cushion link cover.



RIGHT REAR SEAT CUSHION LINK COVER 3. Place a pry bar between the right seat cushion outer link and the bracket, and apply pressure in the direction shown.

PRY BAR



PRY BAR

- 4. Check that the seat drops freely. Lift the seat bottom until the spring touches the bracket, then let the seat bottom drop.
 - If the seat drops freely, the repair is complete.
 - If the seat does not drop freely, repeat steps 3 and 4 until the seat drops freely.

SPRING



BRACKET

END