

# TECHNICAL BULLETIN

## LTB00773NAS2

### 25 MAR 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

### **SECTION: 501-08**

## Hood Finisher-To-Hood Clash

### **AFFECTED VEHICLE RANGE:**

#### **Range Rover (LG)**

**Model Year:** 2013-2016  
**VIN:** 001204-265501  
**Assembly Plant:** Solihull

### **MARKETS:**

NAS

### **CONDITION SUMMARY:**

**Situation:** The hood paint may have been 'erased' away by the hood finisher.

**Cause:** This may be caused by a difference between the hood and hood finisher tolerances causing a clash condition.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

### **PARTS:**

LR076042 Hood finisher tape kit Quantity: 1

### **TOOLS:**

Refer to Workshop Manual for any required special tools.

### **WARRANTY:**

**NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.


**NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Hood finisher - Renew	<b>76.43.27</b>	0.3	07	LR052722
Local repair and respray	<b>79.B.AA3</b>	0.6	07	LR052722

**NOTE:** Normal Warranty procedures apply.

### **SERVICE INSTRUCTION:**

1. Check the areas shown for damage.

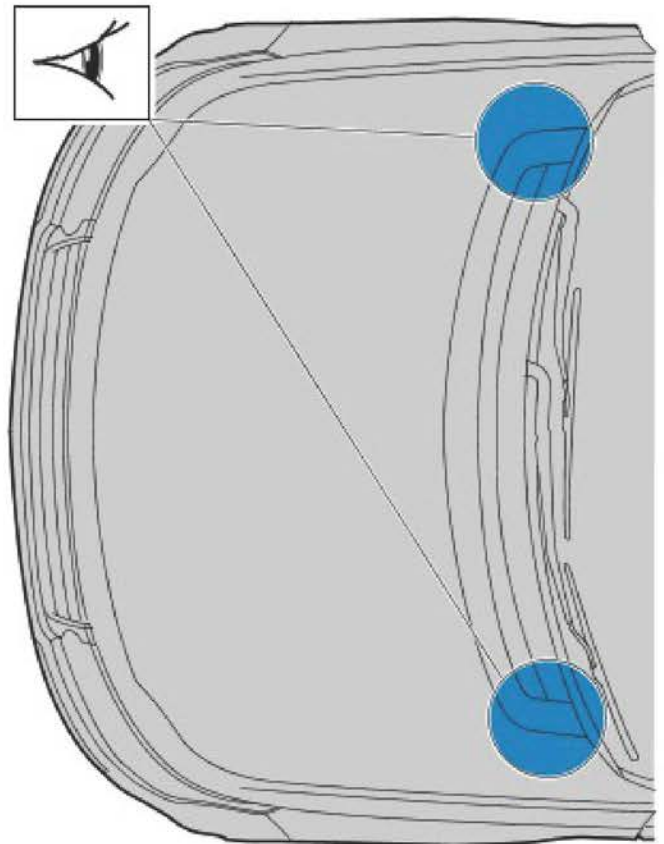


E178230

2.  **CAUTION:** Make sure no further damage is caused to the paintwork.


 **CAUTION:** Make sure no damage is caused to the hood finisher when removing from the hood.

Use a suitable tool to remove the hood finisher.

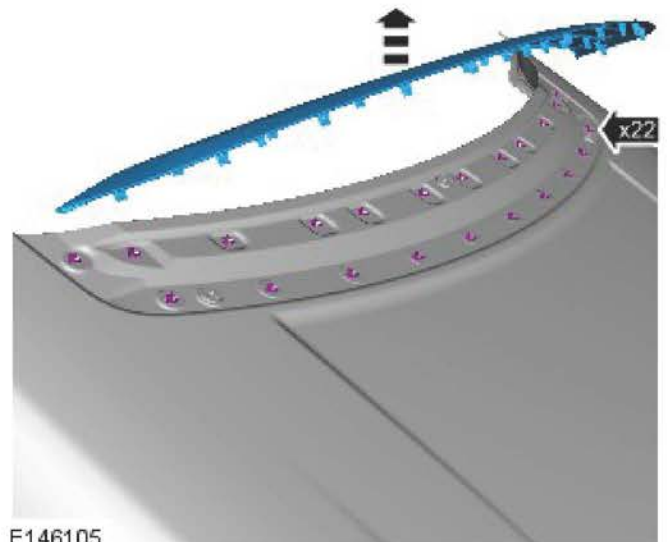


E146105


3. Use a suitable tool to remove the clear hood finisher spacers from both sides of the hood.

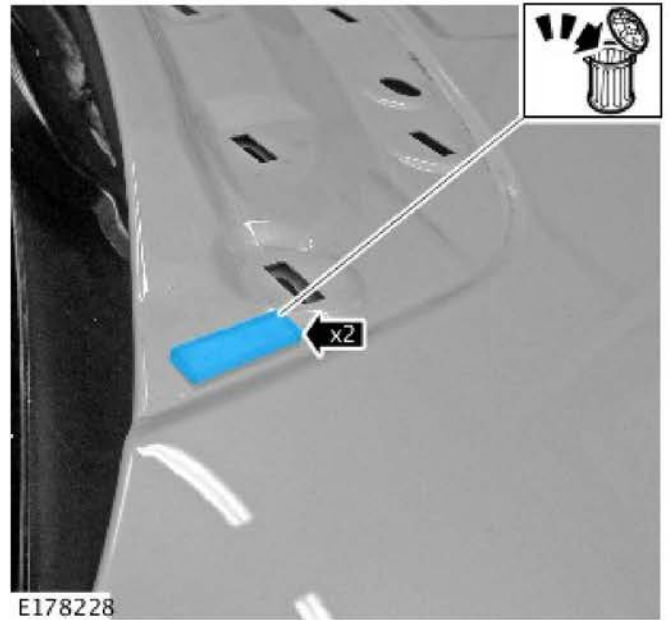

4. Use a suitable degreaser to clean the area shown.

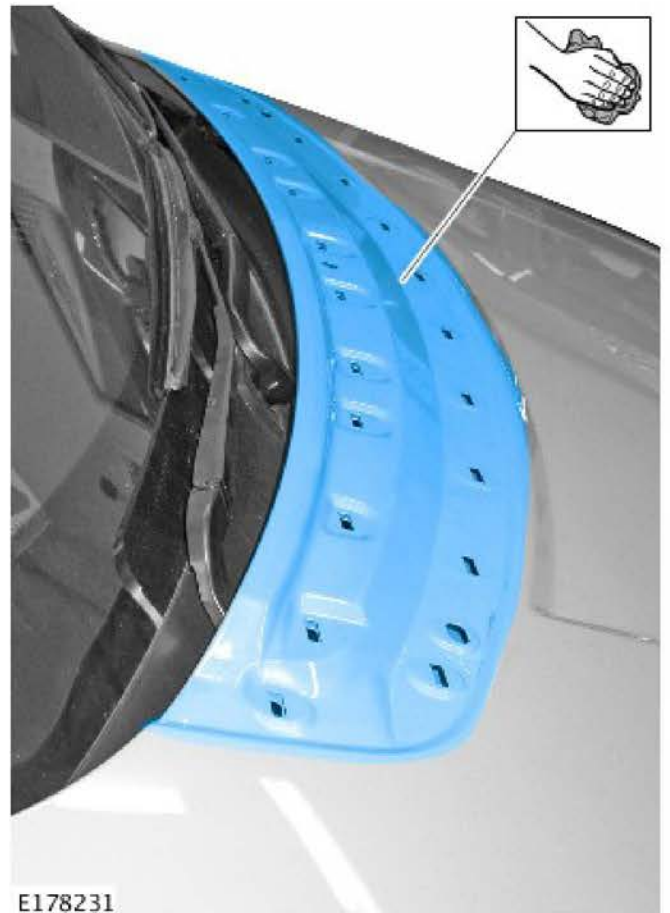


5. Repair and repaint the hood in the damaged areas shown if required.

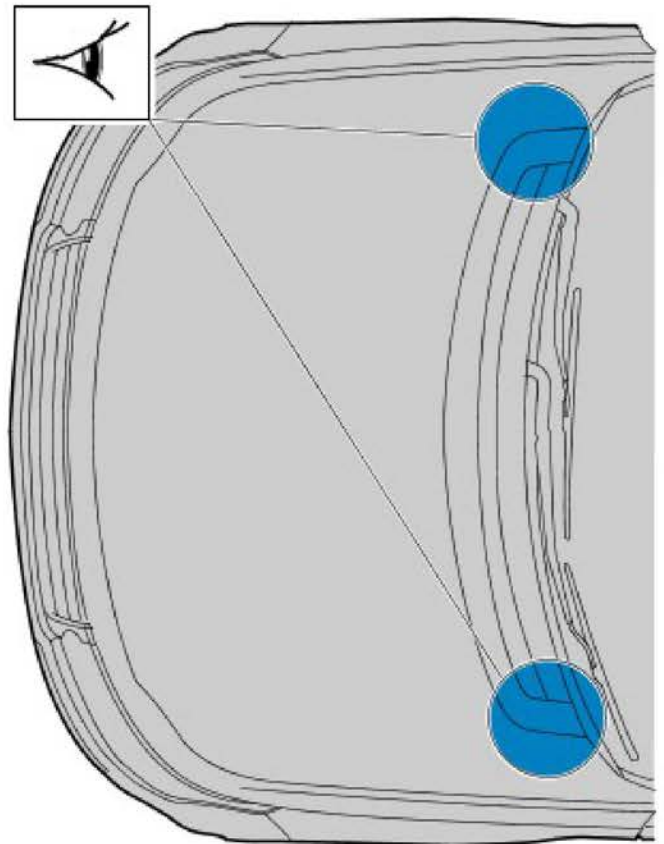

E178230


6. Use a suitable degreaser to clean the hood finisher in the area shown.

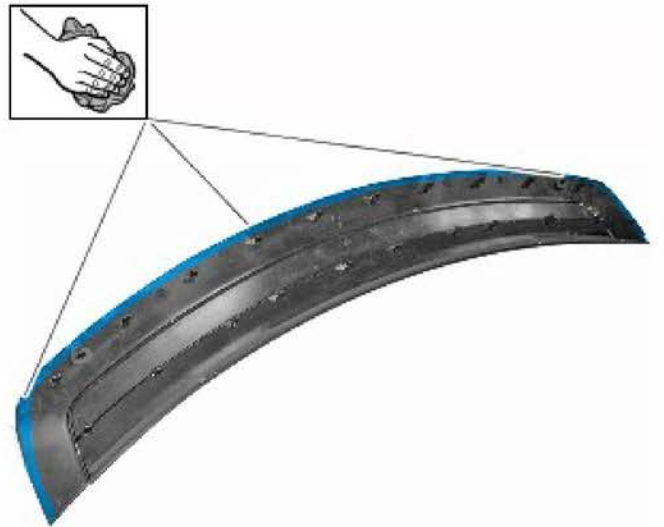


E178232

7. Install the moulding tape in the area shown.

- **A** 3mm thickness x 15mm length
- **B** 1.5mm thickness x 171mm length
- **C** 3mm thickness x 1434mm length

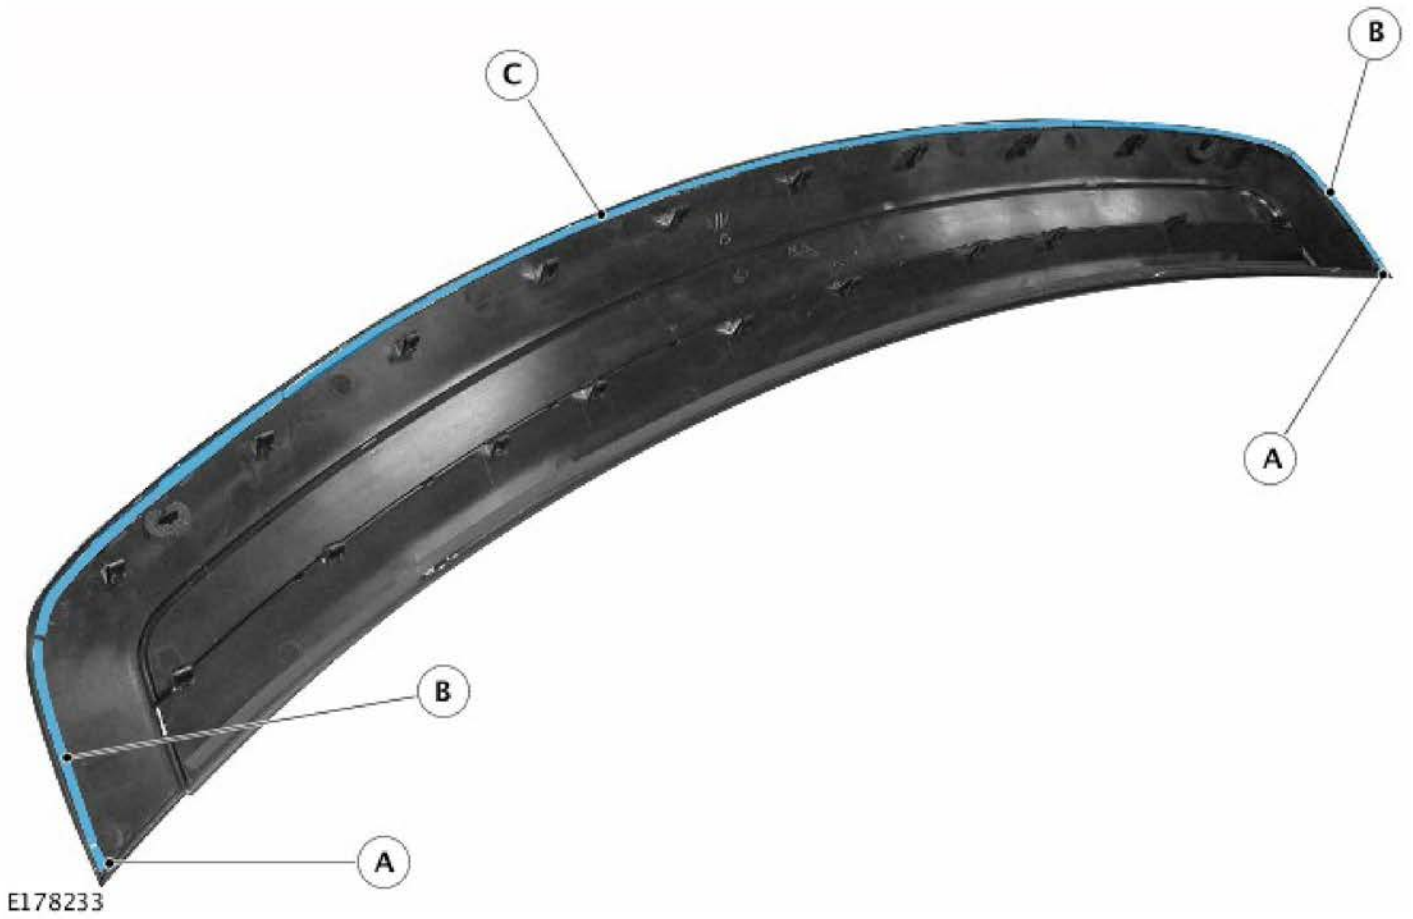

**8.** Remove the moulding tape backing in the area shown.

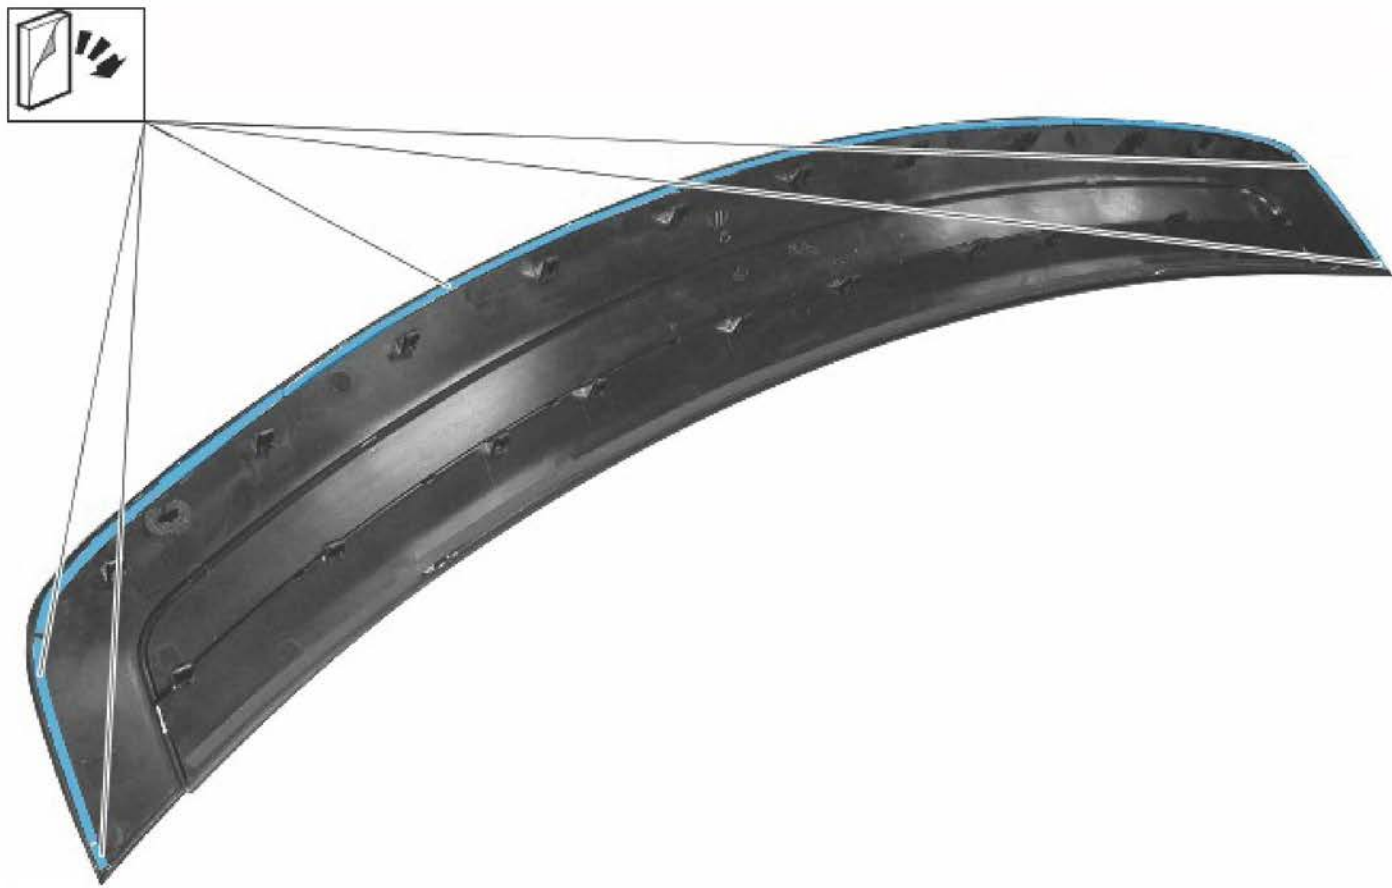


E178234

9.  **CAUTION:** Make sure no damage is caused to the paintwork.

 **NOTE:** Install the hood finisher clips from the middle outwards.

Install the new hood finisher.

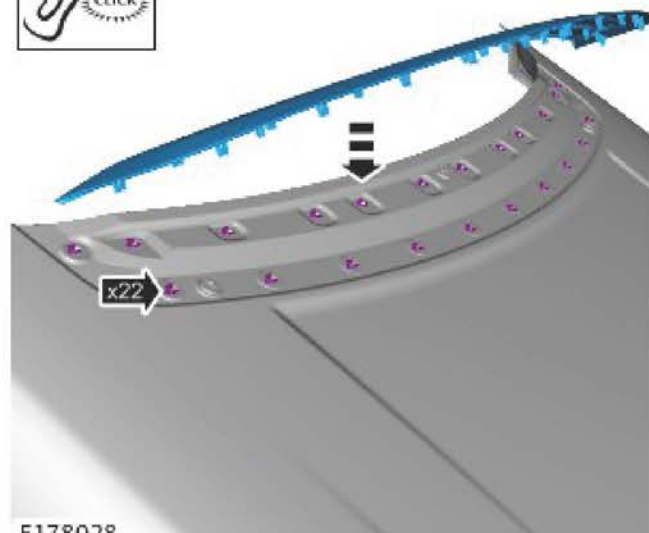

E178028

10. Verify the hood finisher is installed correctly.

