
Reference	SSM72568
Models	Discovery Sport / L550 LR4 / L319 Range Rover / L405 Range Rover Evoque / L538 Range Rover Sport / L494
Title	Customer Reports MIL Illuminated and DEF Malfunction Message Displayed on the Instrument Cluster
Category	Engine
Last modified	07-Jan-2016 00:00:00
Symptom	403000 Exhaust System Concerns

Content**Issue:**

Customer reports Malfunction Indicator Lamp (MIL) will be illuminated.

Other symptoms may be visible to the customer and technician:

- Diesel Exhaust Fluid (DEF) warning displayed within the Instrument pack (IPK)
- DTC's = P249C-00/P205B-84 logged within the Powertrain Control Module (PCM).

Cause:

Software timing within the PCM which controls the DEF temperature strategy.

Action:

Update the PCM software to the latest level using SDD DVD144.02 or later.

Please note – JLR will be releasing a technical service bulletin to support this software enhancement on the 21st January 2016.