

Reference	SSM72570
Models	Range Rover / L405 Range Rover Evoque / L538 Range Rover Sport / L494
Title	Low Battery Warning Displayed On Instrument Cluster
Category	Electrical
Last modified	05-Jan-2016 00:00:00
Symptom	203000 Basic Electrical
Content	<p>Issue: A customer may report that intermittently a 'Low battery warning' message is displayed on the Instrument Cluster message centre, when the vehicle ignition is switched on after the vehicle has been parked overnight. In addition a clicking noise may be heard from the Rear Junction Box when the ignition is switched on.</p> <p>Cause: Software calculation.</p> <p>Action: If a customer reports the above concern, using Symptom Driven Diagnostics with DVD 144, Patch file 2, Software Management Pack 227 or later loaded, reconfigure the existing Gateway Module.</p> <p>Vehicle VIN range affected:</p> <p>Range Rover Evoque – EH706084 onwards</p> <p>Range Rover Sport – EA000001 onwards</p> <p>Range Rover - EA124982 onwards</p>