## TECHNICAL BULLETIN LTB00817NAS2 01 FEB 2016



© Jaguar Land Rover North America, LLC NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions.

		Changes are h	nighlighted in gray		
SECTION: 501-16		15			
Headlamp Washer Jet	Adrift				
AFFECTED VEHICLE R					
State states	ANGL.				
LR4 (LA) Model Year: 2015-20 VIN: 731301- Assembly Plant: Solihull					
MARKETS: NAS					
CONDITION SUMMAR	<u>Y:</u>				
Situation: The headlamp wa	sher jet(s) may be a	adrift in the front	bumper cover.		
Cause: This may be caused	by the adhesive not	being to specifica	tion.		
Action: Should a customer e	xpress this concern,	follow the Servic	e Instruction below.		
PARTS:					
$\wedge$					
NOTE: either adhesive m	ay be used; DP800	)5 has a lower c	ure time.		
NOTE: source the adhesive claimed for the first vehicle	ve, applicator, plu e that is repaired.	nger, and nozzle	es from a local 3M™	supplier. The applicator	and plunger may only
NOTE: use the correct siz	e of plunger for th	ne adhesive use	d.		
NOTE: for the adhesive, o	claim 'ZZZ001', \$2	5.60.			
NOTE: for the applicator,	claim 'ZZZ001', \$4	45.36.			
NOTE: for the nozzle, cla	im 'ZZZ001', \$16.2	20.			
<u>.</u>	3M™ Scotch-Weld™	Structural Plasti	ic Adhesive DP8005	Quantity: 1 (locally sourc	ed)
÷	3M <sup>™</sup> Scotch-Weld <sup>™</sup> Structural Plastic Adhesive DP8010		c Adhesive DP8010	Quantity: 1 (locally sourced)	
-	3M <sup>™</sup> Scotch-Weld <sup>™</sup> EPX <sup>™</sup> Plus II Applicator with 10:1 Plunger			Quantity: 1 (locally sourced)	
	3M <sup>™</sup> Scotch-Weld <sup>™</sup>	<sup>™</sup> EPX <sup>™</sup> Applicato	r Nozzle	Quantity: 1 (locally sourc	ed)
<u> OOLS:</u>					
TOOLS: Refer to Workshop Manual fo	or any required speci	al tools.			
Refer to Workshop Manual fo	or any required speci	al tools.			
Refer to Workshop Manual fo	res are under con	stant review, ar	nd therefore times a he latest repair tim	re subject to change; the e.	ose quoted here must
Refer to Workshop Manual fo <b>WARRANTY:</b> NOTE: Repair procedu be taken as guidance only. NOTE: DDW requires to	ires are under con Always refer to Ti	stant review, ar OPIx to obtain t	he latest repair tim	re subject to change; the e. st show the causal part i	
WARRANTY: NOTE: Repair procedu be taken as guidance only.	nres are under com Always refer to To the use of causal p	stant review, ar OPIx to obtain t	he latest repair tim	е.	



## **SERVICE INFORMATION:**

1Equipment to be used for the bonding of the headlamp washer jet mounting plate to the bumper cover.

- Plunger (1)Applicator (2)
- Adhesive (3)
  Nozzle (4)



E181857

## SERVICE INSTRUCTION:


NOTE: removal steps in this procedure may contain installation details.

NOTE: some variation in the illustrations may occur, but the essential information is always correct.

1Remove the front bumper cover (see TOPIx Workshop Manual, section 501-19).



Remove the headlamp washer hose from the front bumper cover.

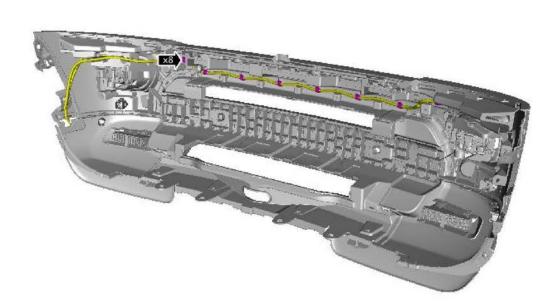


E181648



make sure the locating tangs are aligned. Failure to follow this instruction may result in damage to the vehicle.


Remove the front bumper cover supporting bracket.

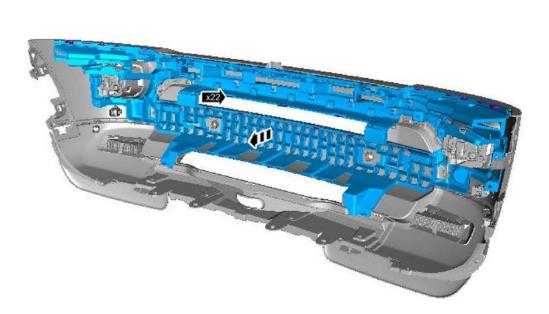

E181649

4Remove the retaining clip from the right-hand headlamp washer jet.


 Remove the right-hand headlamp washer jet from the front bumper cover.

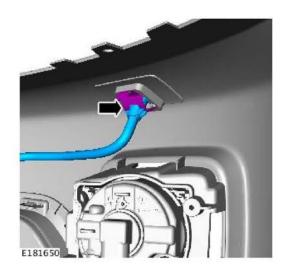

5Remove the right-hand headlamp washer jet mounting plate from the front bumper cover.



6Remove the adhesive pad from the right-hand headlamp washer jet mounting plate.

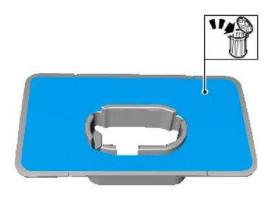

E181652


7 ANOTE: using a suitable cleaning agent, clean the area prior to applying the adhesive.

Using a suitable abrasive material, prepare the front bumper cover for bonding.



8 NOTE: using a suitable cleaning agent, clean the area prior to applying the adhesive.

Using a suitable abrasive material, prepare the right-hand headlamp washer jet mounting plate for bonding.

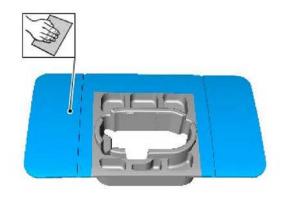


E181654

9 CAUTION: make sure to follow the relevant instructions for the adhesive used in this Step.

CAUTION: make sure that the adhesive is applied as illustrated to avoid excess adhesive being pushed through the hole in the bumper cover when fitting the mounting plate.

Apply a suitable adhesive to the right-hand headlamp washer jet mounting plate.

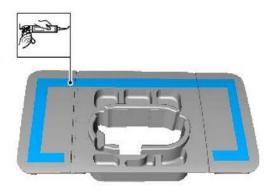

E181655


10 CAUTION: make sure to follow the relevant instructions for the adhesive used in this Step.

Install the headlamp washer jet mounting plate on to the front bumper cover.



11Repeat steps 4-10 to the left-hand headlamp washer jet.

12When installing the headlamp washer pipe, align the one-way valve to the bumper wiring harness retaining clip so the hose is not under tension.

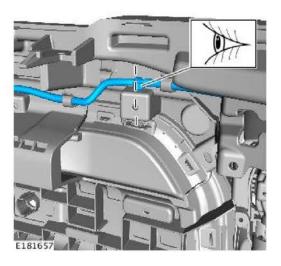

13To install, reverse the removal procedure.