Reference	SSM72080
Models	Range Rover / L405
	Range Rover Sport / L494
Title	L405/L494 – Differential Pinion Oil Seal Leaks - Kits Now Available
Category	Driveline
Last modified	19-Feb-2016 00:00:00
Symptom	509000 Axle Concerns
Attachments	1Pinion Oil Seal Kit.pdf (1Pinion Oil Seal Kit.pdf)
Content	Issue:
	Differential pinion oil seal leak

Differential pinion oil seal leak.

Cause:

Pinion seal previously not available as a serviceable component leading to differential replacements.

Action:

Front and rear differential pinion oil seal kits are now available via service parts.

Differential replacement is no longer required for leaks associated to the pinion oil seal.

Part numbers

Front Differential Pinion Oil Seal Kit - LR067897 Rear Differential Pinion Oil Seal Kit - LR068951

Attached file shows an example of the rear differential oil seal kit contents (front similar).

For repair procedure please refer to TOPIx as follows -

205-03: Front Drive Axle/Differential - Removal and Installation - Drive Pinion Seal 205-02: Rear Drive Axle/Differential - Removal and Installation - Drive Pinion Seal

Greased seals introduced from production at the following vin numbers -

GA281844 - LG Range Rover

GA580870 - LW Range Rover Sport