

Reference	SSM72579
Models	Discovery Sport / L550
Title	L550 - Rear Park Aid Inoperative
Category	Electrical
Last modified	15-Feb-2016 00:00:00
Symptom	203000 Basic Electrical
Attachments	Label.pdf (Label.pdf)

Content Issue: Customers are reporting that the rear park aid has ceased to function.

Cause: Possible water ingress to connectors C44H/J with fault codes:

- B1B44 - 14
- B1B44 - 96
- B1B46 - 96

Action: Please check the in-line connector quoted above for water ingress. If there are signs of corrosion please check

1. The security of the connector
2. The integrity of the seals within the connector
3. The rear Fog Lights for signs of water ingress..
4. The rear Park Aid sensors for contamination,

Confirm by EPQR, how the vehicle has been robustly repaired, including a FRED request for harness replacement if required.

If the fog lamp is damaged, please replace it with the latest level part in MicroCat. Latest level parts can be identified with a green dot on the manufacturer's label. Further more, the production date will be after 20/11/2015. Both of these are highlighted on the picture attached.

Fog lamp service part numbers are as follows:

- LR060910
- LR060911




012.004-01

Made in Slovenia

AC

00000559

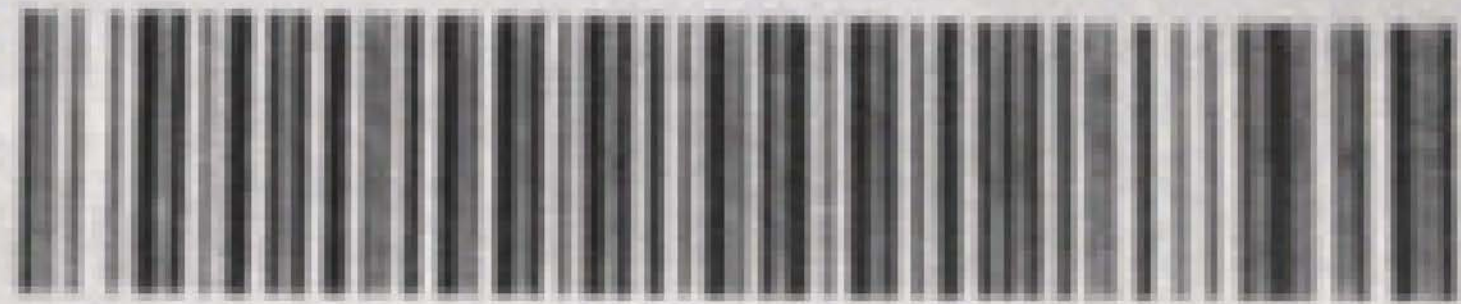

16.01.16

10:22:24

FK72 15K273-AA