
Reference	SSM72765
------------------	----------

Models	Range Rover / L405 Range Rover Sport / L494
---------------	--

Title	Electronic Park Brake Control Module (EPBCM) flags C1059-62
--------------	---

Category	Chassis
-----------------	---------

Last modified	12-May-2016 00:00:00
----------------------	----------------------

Symptom	302000 Parking Brake System
----------------	-----------------------------

Content	<p>Issue:</p> <p>EPBCM (Electronic Park Brake Control Module) shows DTC C1059-62 - Left And Right Actuator - Internal Temperature Sensors - Signal compare failure. Within following VIN ranges, LG274001-285028, LW571452-LW584863 and LW644695-LW651468</p> <p>Cause:</p> <p>EPBCM calibrated incorrectly at supplier - this leads to the DTC flagging which guides technicians to replace EPB actuators.</p> <p>Action:</p> <p>As per TOPIX workshop manual: check integrity of harnesses / connectors from electronic parking brake module to actuators. If no error states are identified then proceed with replacement of the EPBCM. Flash latest level software onto module using SDD.</p> <p><u>Note:</u> Longitudinal G-sensor must be calibrated on flat and level ground</p>
----------------	---