

TECHNICAL BULLETIN
LTB00891NAS2
31 MAY 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in gray

SECTION: 501-08

Roof Opening Panel Rear Glass Seal Loose

AFFECTED VEHICLE RANGE:

Range Rover (LG)

Model Year: 2013 Onwards

VIN: 001204 Onwards

Assembly Plant: Solihull

Vehicles With: Roof Opening Panel

Range Rover Sport (LW)

Model Year: 2014 Onwards

VIN: 001154 Onwards

Assembly Plant: Solihull

Vehicles With: Roof Opening Panel

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The roof opening panel rear glass seal may be loose / adrift.

Cause: This may be caused by the seal becoming degraded.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:

LR084562 Rear Glass Roof Panel Seal 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:


 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**


 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Rear Glass Roof Panel Seal - Renew	76.81.89.41	0.3	07	LR084562

 **NOTE: Normal Warranty procedures apply.**


SERVICE INSTRUCTION:

1.  **NOTE: Range Rover Sport (L494) shown; Range Rover (L405) similar.**
Component location.

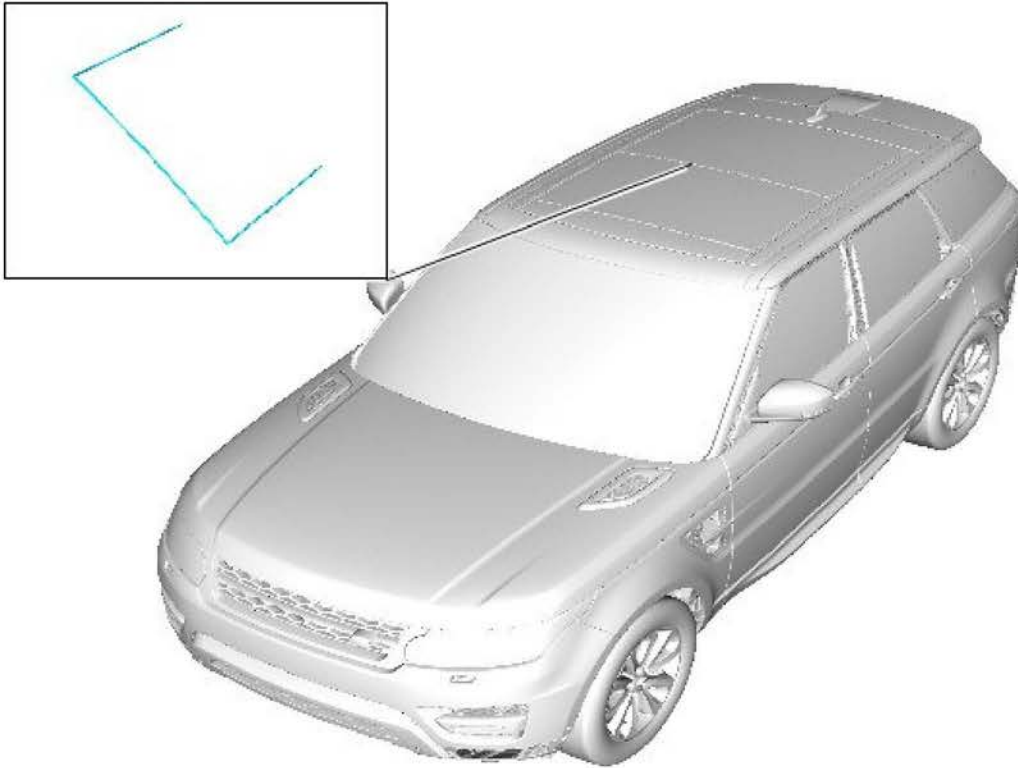


E186000


2.  **NOTE: Repeat this step on both sides of the vehicle.**
Remove the roof moldings (see TOPIX Workshop Manual, section 501-08: Exterior Trim and Ornamentation).
3. Open the roof opening panel to the vent position.
4.  **NOTE: Note the orientation of the rear glass roof panel seal when removing from the vehicle.**
Remove the roof opening panel rear glass seal.

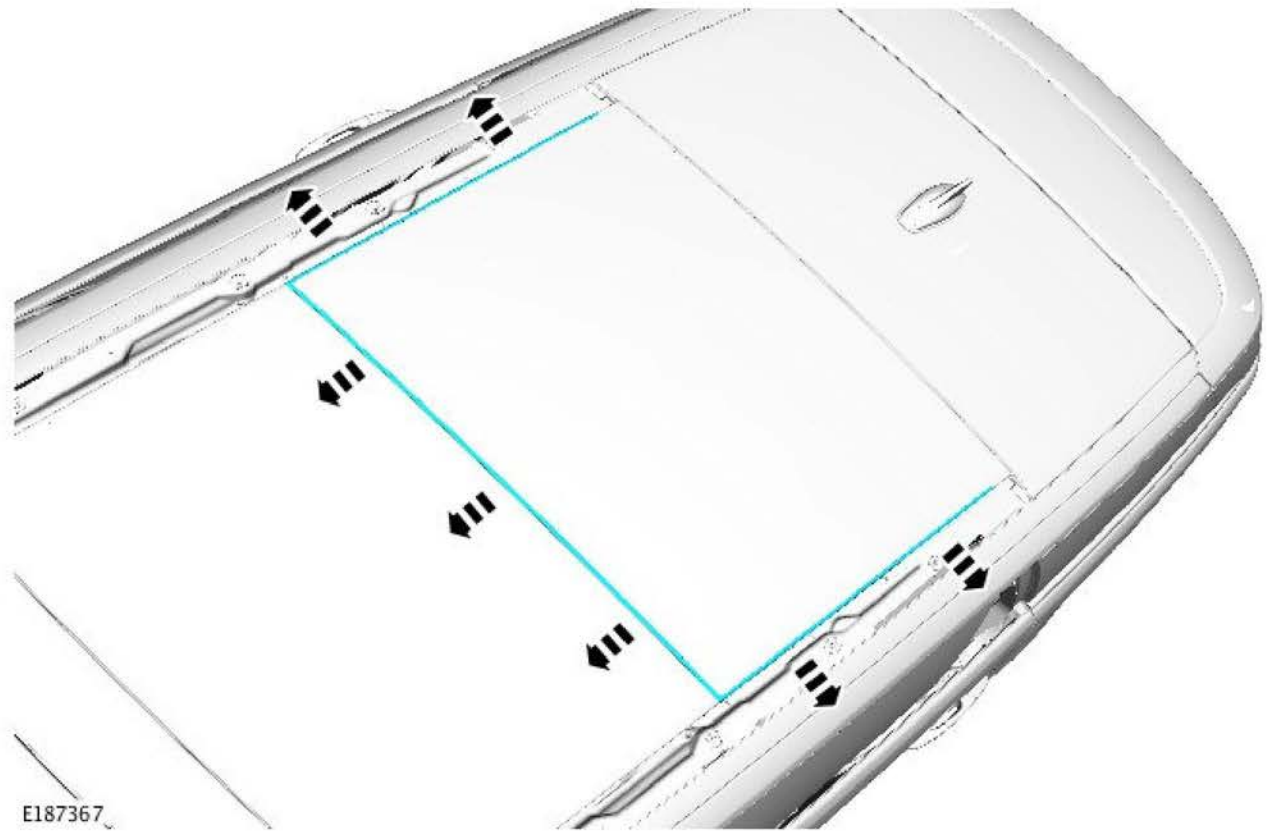

5. Use a suitable cloth to wipe clean the area shown.

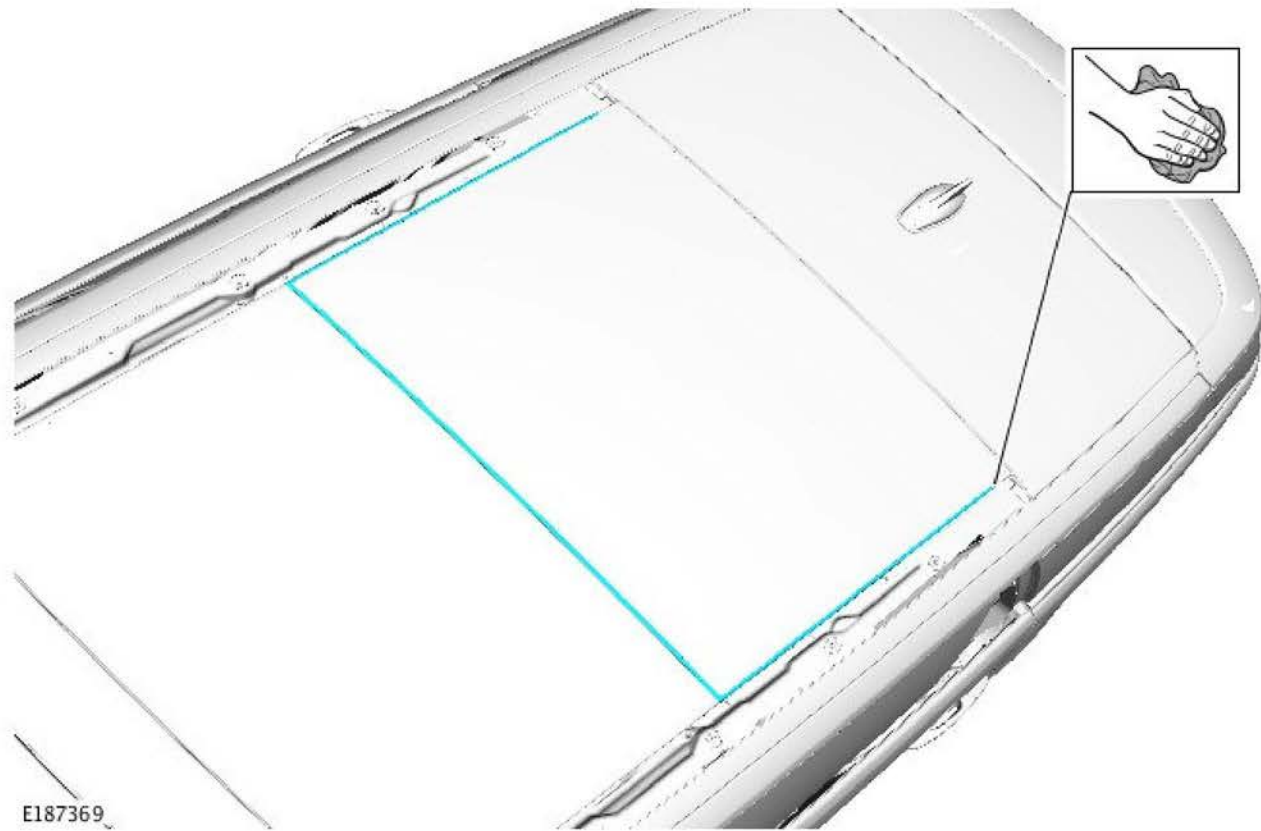

6. Use a suitable solution (2ml mild soap per 1L of water), wet the area shown.

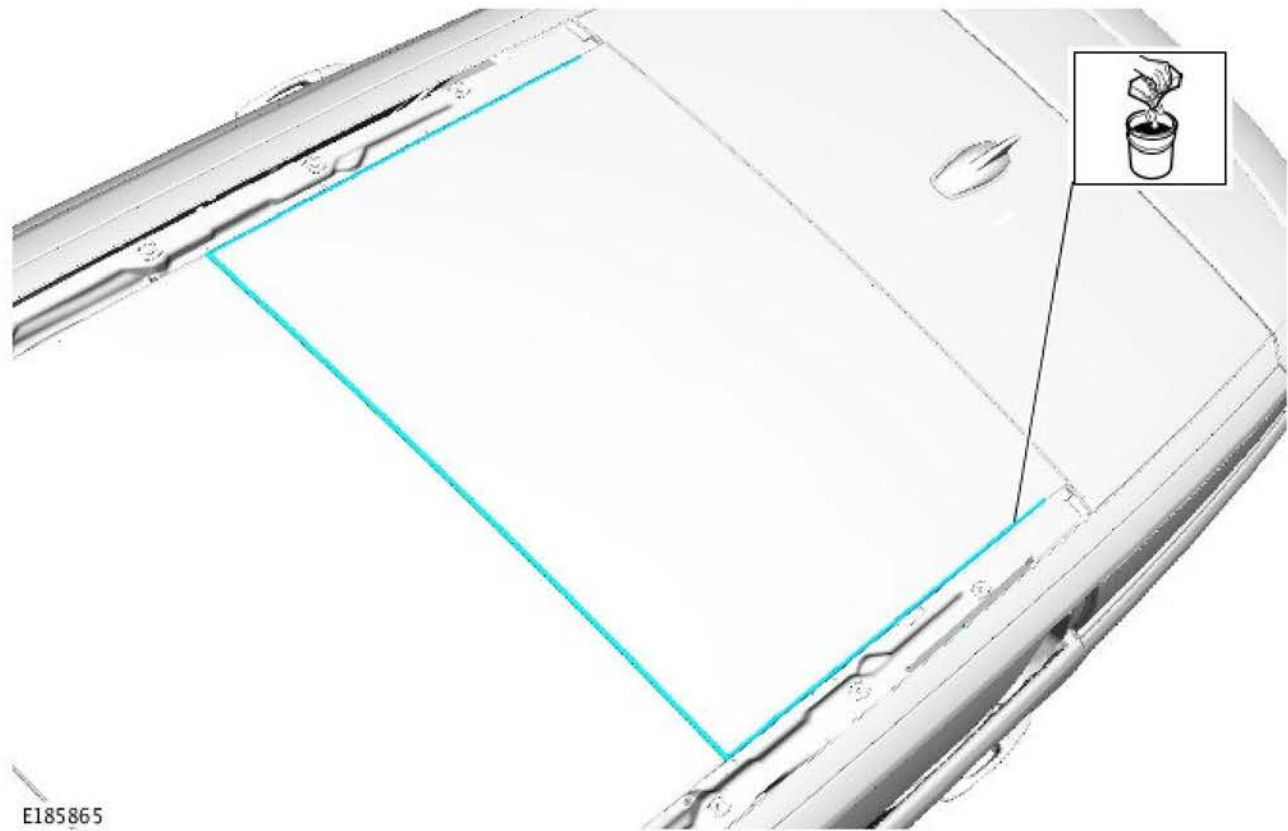


7.  **CAUTION: Make sure the roof opening panel rear glass seal is correctly installed and fully located.**

 **NOTE: Make sure the seal is installed in the correct orientation.**

Install the new roof opening panel rear glass seal.

1. Make sure the end and the corners of the roof opening panel rear glass seal are installed first.
2. Install the roof opening panel rear glass seal in the order shown.

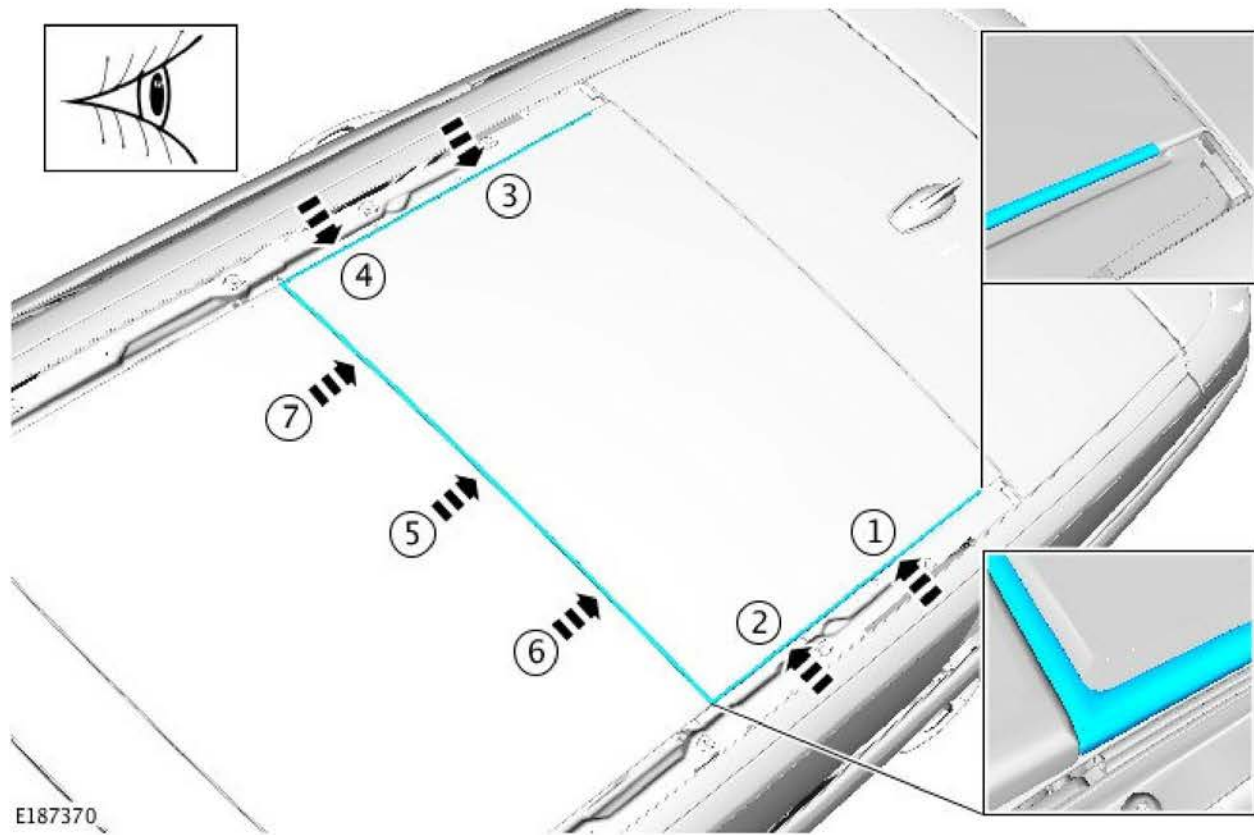

8.  **NOTE: Repeat this step on both sides of the vehicle.**

Install the roof moulding (see TOPIX Workshop Manual section 501-08: Exterior Trim and Ornamentation).

9. Close the roof opening panel.