

TECHNICAL BULLETIN
LTB00956NAS1
27 MAY 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-10

Unsatisfactory Second Row Seat Comfort

AFFECTED VEHICLE RANGE:

Discovery Sport (LC)

Model Year: 2015-2016

VIN: 500429-594984

Assembly Plant: Halewood

MARKETS:

NAS

CONDITION SUMMARY:

Situation: On vehicles fitted with heated second row seating, a hard 'lump' may be felt through the surface of the second row seat cushion cover while sitting on the seat

Cause: This may be caused by incorrect positioning of the heater mat within the second row seat cushion.

Action: Should a customer express concern, follow the Service Instruction below.

PARTS:

No Parts Required

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Cover - Rear seat cushion - RH - Renew	78.40.04	0.4	07	LR059285
Cover - Rear seat cushion - LH/each - Renew	78.40.05	0.5	07	LR059285

 **NOTE: Normal Warranty procedures apply.**

SERVICE INSTRUCTION:

1. Remove the affected second row seat cushion heater mat (see TOPIx Workshop Manual section 501-10: Seating - Rear Seat Cushion Heater Mat).
2. Visually check that the heater mat is installed correctly (✓) with the control unit positioned within the foam cut-out as shown.

- If the heater mat is installed correctly (✓) with the control unit positioned within the foam cut-out, continue to the next step.
- If the heater mat is not installed correctly (✗) with the control unit positioned within the foam cut-out, reposition as necessary.
 - Continue to the next step.



3. Install the second row seat cushion heater mat (see TOPIx Workshop Manual section 501-10: Seating - Rear Seat Cushion Heater Mat).