
Reference	SSM72822
Models	Range Rover Sport / L494
Title	3rd Row Seat Not Returning to Fully Upright Position
Category	Body
Last modified	02-Jul-2016 00:00:00
Symptom	101000 Seating

Content **Issue:** A customer may report a concern that the 3rd row seat does not fully return to the upright position when requested. On selection of the button the seat may stop in the mid position. Any subsequent button presses will not operate the seat.

Cause: Seat may lose its calibrated position over a number of seat fold cycles.

Action: Please follow the diagnostic path below where the customer reports the concern:

1. Connect Symptom Driven Diagnostics (SDD) and check for any Diagnostic trouble Codes (DTCs) stored in the Driver or Passenger Seat Modules. If there are no fault codes stored continue to step 2. If there are fault codes stored continue with diagnosis using SDD and reference to TOPIx.
2. Using SDD carry out a rear seat calibration of the affected seat. This will return the seat to upright position and normal operation will re-commence.

Note: There is no requirement to replace the seat module or seat frame for this condition.