

Reference	SSM72892
Models	Range Rover / L405 Range Rover Sport / L494
Title	3.0 TDV6 Hesitation At Altitude (USA and Canada)
Category	Driveability
Last modified	25-Jul-2016 00:00:00
Symptom	611000 Hesitation/Stumble

Content**Issue:**

A Customer may express a concern that there is a hesitation when pulling away in first gear.

Cause:

Software update required.

Action:

This workaround will load a software file to SDD using the Manual Patch Update process.

NOTE: When a SDD software update has been applied to the SDD machine, this Manual Patch will need to be re-applied until the permanent corrective action is delivered (due on DVD146.06).

To install this Manual Patch complete the instruction listed below:

1. Restart the SDD machine
2. Login to SDD.
3. Select 'Continue' on the SDD Warning screen.
4. Select 'Settings' tab.
5. Select 'System Utilities'.
6. Select 'Manual Patch Update'.
7. A pop-up will be displayed for Manual patch selection dialog box.
8. Enter '**MP_JLR_L0023**' in the Manual patch selection dialog box.
9. Select 'OK'.
10. The 'Software Management Wizard' will then download the fix file.
11. The Manual patch update information pop up will ask 'Do you want to install the update now?' Select 'OK'.
12. Select 'OK' when the message 'Please shut down SDD before continuing' is displayed. DO NOT SHUT DOWN THE PC.
13. MP_JLR_L0023 pop up message will be displayed with progress bar and will disappear when complete. DO NOT select 'Cancel'.

14. Select 'OK' in the Manual patch update information pop up.
15. Close the Internet Explorer Window where the SDD program runs.
16. Start a new SDD session.
17. Program the Powertrain Control Module (PCM).

SRO 12.90.13 engine management tune download.

If this manual patch fails to correct the concern then a Technical Assistance should be escalated to your local Technical Support.