

LTB00868NAS2

TECHNICAL BULLETIN

01 MAR 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

501-20A

SUBJECT/CONCERN:Front Seatbelt(s) Slow to Retract

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
LR4 (LA)	2010-2014	510178-747648	Solihull

MARKETS:NORTH AMERICA

CONDITION SUMMARY:**SITUATION:**

The front seatbelt(s) may be slow to retract.

CAUSE:

This may be caused by the design of the upper B-pillar trim, allowing the seatbelt to drag on the upper B-pillar trim.

ACTION:Should a customer express this concern, follow the Service Instruction below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY:
LR069022	Right Side Upper 'B' Post Trim	1
LR069021	Left Side Upper 'B' Post Trim	1
LR020242	L/H/D Seat Belt Black Left Hand	1
LR009282	L/H/D Seat Belt NAS Spec Black Right Hand	1

PART NUMBER	DESCRIPTION	QUANTITY:
EYG500230	Seat Belt Retractor Bolt	1
LR080344	Seat Frame Seat Belt Anchor Bolt	1

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Trim finisher - B-pillar - Upper - Renew	76.13.28	0.3	42	LR013145
Automatic belt assembly - Front - Each - Renew	76.73.13	0.4	42	LR013145

NOTE:


Normal Warranty procedures apply.

COMPONENT LOCATION

¹

NOTE:

right-side B-pillar shown; left-side B-pillar similar.

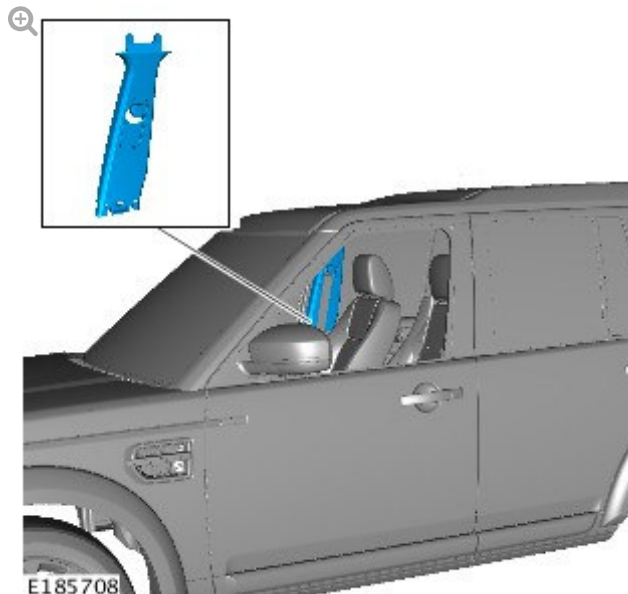

Component location.

SERVICE INSTRUCTION:

NOTE:

ALL seatbelt anchor bolts MUST be replaced if removed.

-
- 1 Remove the B-pillar trim finisher (see TOPIx Workshop Manual, section 501-05: Interior Trim and Ornamentation).

NOTES:

- the seatbelt MUST be changed If the webbing of the seatbelt is damaged .
- the seatbelt should fully retract within three seconds.

-
- 2 Check the seatbelt retraction speed and the seatbelt webbing.
 - 1 To test the retraction speed of the seatbelt, sit in the vehicle and buckle the seatbelt.

2 Release the buckle.

- The webbing should retract within three seconds (different clothing may have an impact on the retraction speed).
 - If the retraction speed is not acceptable or the webbing is damaged, continue to step 3.
 - If the retraction speed is acceptable and the webbing is in good condition, continue to step 4.

3 Replace the front seatbelt (see TOPIx Workshop Manual, section 501-20A: Safety Belt System).

4 Install the new B-pillar trim finisher (see TOPIx Workshop Manual, section 501-05: Interior Trim and Ornamentation).

5 With the new trim installed, assess the retraction speed of the seatbelt.

- The seatbelt should fully retract within three seconds.