

LTB01045NAS1

TECHNICAL BULLETIN

29 MAR 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:

206-04

SUBJECT/CONCERN:

Noise From Rear Brakes When Reversing

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover Evoque (LV)	2016 Onwards	048210 Onwards	Halewood

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

A 'groan', 'drone', 'honk', and/or 'graunch' noise may be heard from the rear brakes, most noticeable during light braking when reversing after an initial start in colder ambient temperatures.

CAUSE:

This may be caused by delamination of the rear brake pad shim.

ACTION:

Should a Customer express this concern, follow the Service Instruction below.

PARTS:

NOTE:

An Electronic Product Quality Report (EPQR) containing an audio or video (with sound) file must be submitted prior to ordering part number LR090707. The VIN and EPQR number must be in the Customer Material Field.

PART NUMBER	DESCRIPTION	QUANTITY:
LR090707	Rear brake pad kit	1

WARRANTY:

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Brake Pads - Rear - Set - Renew	70.40.03	0.6	42	LR061385

NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

NOTE:

This Service Instruction is only applicable to address the specified noises in the Condition Summary (reverse, low frequency noise). Use of the listed parts to address issues other than the specified noises in the Condition Summary may create greater Customer dissatisfaction. See SSM73150 in GCM, reference noise type '5', for an example of the noise this Technical Bulletin will address.

-
- 1 Renew the rear brake pads (see TOPIx Workshop Manual section 206-04: Rear Disc Brake - Brake Pads).